

Source Water Assessment

A Hydrogeologic Susceptibility and Vulnerability Assessment for Tri-Valley Community Center Public Drinking Water System, Healy, Alaska PWSID # 391087.001

DRINKING WATER PROTECTION REPORT 1832

Alaska Department of Environmental Conservation

February, 2009

Source Water Assessment for Tri-Valley Community Center Public Drinking Water System, Healy, Alaska PWSID# 391087.001

DRINKING WATER PROTECTION REPORT 1832

The Drinking Water Protection (DWP) section of the Drinking Water Program is producing Source Water Assessments in compliance with the Safe Drinking Water Act Amendments of 1996. Each assessment includes a delineation of the source water area, an inventory of potential and existing contaminant sources that may impact the water, a risk ranking for each of these contaminants, and an evaluation of the potential vulnerability of these drinking water sources.

These assessments are intended to provide public water systems owners/operators, communities, and local governments with the best available information that may be used to protect the quality of their drinking water. The assessments combine information obtained from various sources, including the U.S. Environmental Protection Agency, Alaska Department of Environmental Conservation (DEC), public water system owners/operators, and other public information sources. The results of this assessment are subject to change if additional data becomes available. It is anticipated this assessment will be updated every five years to reflect any changes in the vulnerability and/or susceptibility of public drinking water source. If you have any additional information that may affect the results of this assessment, please contact the DWP staff at the following toll-free number 1-866-956-7656.

February, 2009

CONTENTS

Page	Page
Executive Summary1	Ranking of Contaminant Risks2
Tri-Valley Community Center Public Drinking Water	Vulnerability of Tri-Valley Community Center
System	Drinking Water System
Tri-Valley Community Center Drinking Water	References5
Protection Area1	Appendix A7
Inventory of Potential and Existing Contaminant	Appendix B9
Sources	Appendix C11

TABLES

Table 1.	Definition of Zones	.2
Table 2.	Susceptibility	.3
	Contaminant Risks	
Table 4.	Overall Vulnerability	.4

APPENDICES

APPENDIX

A. Tri-Valley Community Center Drinking Water Protection Area (Map A)

- B. Contaminant Source Inventory for Tri-Valley Community Center (Table 1) Contaminant Source Inventory and Risk Ranking for Tri-Valley Community Center – Bacteria and Viruses (Table 2) Contaminant Source Inventory and Risk Ranking for Tri-Valley Community Center – Nitrates/Nitrites (Table 3) Contaminant Source Inventory and Risk Ranking for Tri-Valley Community Center – Volatile Organic Chemicals (Table 4)
- C. Tri-Valley Community Center Drinking Water Protection Area and Potential and Existing Contaminant Sources (Map C)

Drinking Water Protection Alaska Department of Environmental Conservation

EXECUTIVE SUMMARY

The public water system for Tri-Valley Community Center is a Class B (transient/non-community) water system consisting of one well located on Healy Spur Road in Healy, Alaska. The wellhead received a susceptibility rating of Low and the aquifer received a susceptibility rating of Very High. Combining these two ratings produces a **Medium** rating for the natural susceptibility of the well. Identified potential and current sources of contaminants for Tri-Valley Community Center public drinking water source include: assumed septic systems, assumed heating oil tanks, a coal mining area, and roads. These identified potential and existing sources of contamination are considered as sources of bacteria and viruses, nitrates and/or nitrites, and volatile organic chemicals. Overall, the public water sources for Tri-Valley Community Center received a vulnerability rating of Low for bacteria and viruses, Medium for nitrates and nitrites, and High for volatile organic chemicals. This assessment of contaminant risks can be used as a foundation for local voluntary protection efforts as well as a basis for the continuous efforts on the part of Tri-Valley Community Center to protect public health.

TRI-VALLEY COMMUNITY CENTER PUBLIC DRINKING WATER SYSTEM

Tri-Valley Community Center public water system is a Class B (transient/non-community) water system. The system consists of one well located on Healy Spur Road in Healy, Alaska (see Map A in Appendix A). The community of Healy (pop. 1,000) is located approximately 78 miles southwest of Fairbanks, on the George Parks Highway, a few miles north of the entrance to Denali National Park. The Healy area averages over 15 inches of precipitation per year, with approximately 73 inches of annual snowfall (ADCCED, 2009).

Healy is located near the confluence of Healy Creek and the Nenana River. The area is dominated by several steep peaks to the south, including Mount Healy, with somewhat gentler terrain to the north. The town itself has relatively flat topography. Drainage is typically towards the Nenana River or one of its tributaries.

The majority of residents in Healy have private water wells and septic systems; others haul water from a

community well source. There are no municipal water or sewage facilities (ADCCED, 2009).

The surficial geology of the Healy area consists mainly of glacial outwash gravel of various ages, together with some recent river terrace gravels. Nenana Gravel, a poorly-consolidated conglomerate and coarse sandstone with interbedded mudflow deposits and thin claystone and lignite, is found in the mountainous terrain northeast of Healy (Wahrhaftig, 1970).

According to well documentation, the well is extends approximately 100 feet below the ground surface. No well log is available for this system, therefore it is assumed to be completed in an unconfined aquifer based on information from nearby public water systems. This system operates year-round and serves fourteen residents and twenty-five non-residents through one service connection.

TRI-VALLEY COMMUNITY CENTER DRINKING WATER PROTECTION AREA

In order to evaluate whether a drinking water source is at risk, we must first evaluate what are the most likely pathways for surface contamination to reach the groundwater. These areas are determined by looking at the characteristics of the soil, groundwater, aquifer, and well.

The most probable area for contamination to reach the drinking water well is the Drinking Water Protection Area. The Drinking Water Protection Area is the area circling the well (the area influenced by pumping) and also the area upgradient of the well, usually forming a parabola shape. Because releases of contaminants within the protection area are most likely to impact the well, this area will serve as the focus for voluntary protection efforts.

There are many different methods for calculating the size of protection areas. Drinking Water Protection (DWP) uses a combination of two simple groundwater flow equations, the Thiem and uniform flow equations for all groundwater wells screened in unconsolidated material. The orientation of the protection zone is then drawn using a water table elevation map (if available) or a land surface elevation map of the area. The protection zone calculated by DWP is an estimate using the available information and resources, and may differ slightly from the actual capture zone. Because of uncertainties and changing site conditions, a factor of safety is added to the protection zone to form the drinking water protection area for the well.

The parameters used to calculate the shape of this protection zone are general for the whole alluvial plain and were obtained from various United States Geological Survey (USGS) reports, area well logs, and the Groundwater textbook by Freeze and Cherry (Freeze and Cherry, 1979).

The protection areas established for wells by the DEC are usually separated into two zones, limited by the watershed. These zones correspond to differences in the time-of-travel (TOT) of the water moving through the aquifer to the well. An analytical calculation was used to determine the size and shape of the protection area.

The time-of-travel for contaminants within the water varies and is dependent on the physical and chemical characteristics of each contaminant. The following is a summary of the two protection area zones for wells and the calculated time-of-travel for each:

Table 1. Definition of Zones

Zone	Definition
А	Several months time-of-travel
В	Less than the 2 year time-of-travel

The Drinking Water Protection Area for Tri-Valley Community Center was determined using an analytical calculation and includes Zones A and B (see Map A in Appendix A).

INVENTORY OF POTENTIAL AND EXISTING CONTAMINANT SOURCES

DWP has completed an inventory of potential and existing sources of contamination within the Tri-Valley Community Center drinking water protection area. This inventory was completed through a search of agency records and other publicly available information. Potential sources of contamination to the drinking water aquifer include a wide range of categories and types. Potential drinking water contaminants are found within agricultural, residential, commercial, and industrial areas, but can also occur within areas that have little or no development.

For the basis of all Class B public water system assessments, the following three categories of drinking water contaminants were inventoried:

- Bacteria and viruses;
- Nitrates and/or nitrites;
- Volatile organic chemicals

The sources are displayed on Map C of Appendix C and summarized in Table 1 of Appendix B.

RANKING OF CONTAMINANT RISKS

Once the potential and existing sources of contamination have been identified, they are assigned a ranking according to what type and level of risk they represent. Ranking of contaminant risks for a "potential" or "existing" source of contamination is a function of toxicity and volumes of specific contaminants associated with that source. Rankings include:

- Low;
- Medium;
- High; and
- Very High.

Tables 2 through 4 in Appendix B contain the ranking of potential and existing sources of contamination with respect to bacteria and viruses, nitrates and/or nitrites, and volatile organic chemicals.

VULNERABILITY OF TRI-VALLEY COMMUNITY CENTER DRINKING WATER SYSTEM

Vulnerability of a drinking water source to contamination is a combination of two factors:

- Natural Susceptibility; and
- Contaminant Risks.

A score for the Natural Susceptibility of the well is reached by considering the properties of the well and the aquifer.

> Susceptibility of the Wellhead (0-25 Points) + Susceptibility of the Aquifer (0-25 Points)

Natural Susceptibility of the Well (0-50 Points)

A ranking is assigned for the Natural Susceptibility according to the point score:

Natural Susceptibility Ratings						
40-50 pts	Very High					
30 to < 40 pts	High					
20 to < 30 pts	Medium					
< 20 pts	Low					
	40-50 pts 30 to < 40 pts 20 to < 30 pts					

Factors contributing to the susceptibility of the wellhead are: whether the sanitary seal is in place, protection from flooding, and if the well casing is properly grouted.

The wellhead for the Tri-Valley Community Center received a **Low** susceptibility rating. The most recent sanitary survey (12/31/2007) noted some deficiencies in the protection of the wellhead, however, follow-up correspondence revealed that a sanitary seal is installed on the well, the land surface is sloped away from the well, and the well is protected by a concrete pad. Sanitary seals prevent potential contaminants from entering the well, while sloping of the land surface away from the wellhead provides adequate surface water drainage, and concrete or grouting around the wellhead helps to prevent potential contaminants from traveling down the outside of the well casing.

Factors contributing to the susceptibility of the aquifer are: whether the aquifer is confined or unconfined, whether the well is completed in unconsolidated or fractured bedrock, whether wells and bore holes are penetrating the aquifer and, if applicable, the depth and thickness of the confining layer.

As no well log is available for this system, the Tri-Valley Community Center system is assumed to draw water from an unconfined aquifer, based on information from nearby public water systems. The aquifer received a **Very High** susceptibility rating because of its unconfined status and the presence of another well that penetrates the vadose zone within the protection area. Because an unconfined aquifer is recharged by surface water and precipitation that migrates downward from the surface, it is susceptible to contamination from outside sources. Furthermore, the presence of other wells penetrating the vadose zone of the protection area can allow contaminants to travel into the shared aquifer with precipitation and runoff.

Table 2 summarizes the Susceptibility scores and ratings for the Tri-Valley Community Center system.

Table 2. Susceptibility

	Score	Rating
Susceptibility of the	0	Low
Wellhead		
Susceptibility of the	25	Very High
Aquifer		
Natural Susceptibility	25	Medium

Contaminant risks are derived from an evaluation of the routine sampling results of the water system and the presence of potential sources of contamination. Contaminant risks to a drinking water source depend on the type and distribution of contaminant sources. Flow charts are used to assign a point score, and ratings are assigned in the same way as for the natural susceptibility:

	Contaminant Risk Ratings					
40	0-50 pts	Very High				
30	0 to < 40 pts	High				
20	0 to < 30 pts	Medium				
<	20 pts	Low				

Table 3 summarizes the Contaminant Risks for each category of drinking water contaminants for the Tri-Valley Community Center system.

Table 3. Contaminant Risks

Category	Score	Rating
Bacteria and Viruses	12	Low
Nitrates and/or Nitrites	15	Low
Volatile Organic Chemicals	35	High

Finally, an overall vulnerability score is assigned for each water system by combining each of the contaminant risk scores with the natural susceptibility score:

Natural Susceptibility (0-50 Points) + Contaminant Risks (0-50 Points) = Vulnerability of the Drinking Water Source to

Contamination (0-100 Points)

Again, rankings are assigned according to a point score:

Overall Vulnerability Ratings						
80-100 pts	Very High					
60 to < 80 pts	High					
40 to < 60 pts	Medium					
< 40 pts	Low					
	80-100 pts 60 to < 80 pts 40 to < 60 pts					

Table 4 contains the overall vulnerability scores (0-100) and ratings for each of the three categories of drinking water contaminants for the Tri-Valley Community Center system. Note: scores are rounded off to the nearest five.

Category	Score	Rating
Bacteria and Viruses	35	Low
Nitrates and/or Nitrites	40	Medium
Volatile Organic Chemicals	60	High

 Table 4.
 Overall Vulnerability

Bacteria and Viruses

The contaminant risk for bacteria and viruses is **Low** with septic systems and roads contributing to the risk to the drinking water well.

Coliforms (a bacteria) are found naturally in the environment and while not necessarily a direct health threat, they are an indicator of other potentially harmful bacteria in the water, more specifically fecal coliforms and E. coli. These bacteria only come from human and animal fecal waste and can cause diarrhea, cramps, nausea, headaches, and other symptoms (EPA, 2008).

Samples testing positive for bacteria and viruses increase the overall vulnerability of the drinking water source by indicating that the source is susceptible to bacteria and virus contamination. Only a small number of bacteria and viruses are required to endanger public health. Bacteria and viruses have not been detected during recent water sampling of the system at Tri-Valley Community Center (data reviewed in April, 2008).

After combining the contaminant risk for bacteria and viruses with the natural susceptibility of the well, the overall vulnerability of the well to contamination is **Low**.

Nitrates and Nitrites

The contaminant risk for nitrates and nitrites is **Low** with septic systems and roads contributing to the risk to the drinking water well.

The sampling history for Tri-Valley Community Center indicates that nitrates have been detected within the last 5 years, with the highest concentration of 0.451 mg/l detected on 12/14/2006 (data reviewed in April, 2008).

After combining the contaminant risk for nitrates and nitrites with the natural susceptibility of the well, the overall vulnerability of the well to contamination is **Medium**.

Volatile Organic Chemicals

The contaminant risk for volatile organic chemicals is **High** with septic systems, heating oil tanks, a coal mining area, and roads contributing to the risk to the drinking water well.

The drinking water at Tri-Valley Community Center has not recently been sampled for volatile organic chemicals (data reviewed in April, 2008).

After combining the contaminant risk for volatile organic chemicals with the natural susceptibility of the well, the overall vulnerability of the well to contamination is **High**.

Using the Source Water Assessment


This assessment of contaminant risks can be used as a foundation for local voluntary protection efforts as well as a basis for the continuous efforts on the part of Tri-Valley Community Center to protect public health. It is anticipated that Source Water Assessments will be updated every five years to reflect any changes in the vulnerability and/or susceptibility of Tri-Valley Community Center drinking water source.

REFERENCES

- Alaska Department of Commerce, Community and Economic Development (ADCCED), Accessed 2009 [WWW document]. URL: http://www.commerce.state.ak.us/dca/commdb/CF_COMDB.htm
- Freeze, R.A. and Cherry, J.A., 1979. Groundwater. Prentice-Hall, Englewood Cliffs, NJ.
- United States Environmental Protection Agency (EPA), Accessed 2008 [WWW document]. URL: http://www.epa.gov/safewater/contaminants/index.html.
- Wahrhaftig, C., 1970, Geologic Map of the Healy D-4 Quadrangle, Alaska, Department of the Interior, United States Geological Survey, Geologic Quadrangle Maps of the United States series, Map GQ-806, Washington, DC.

APPENDIX A

Tri-Valley Community Center Drinking Water Protection Area Location Map (Map A)

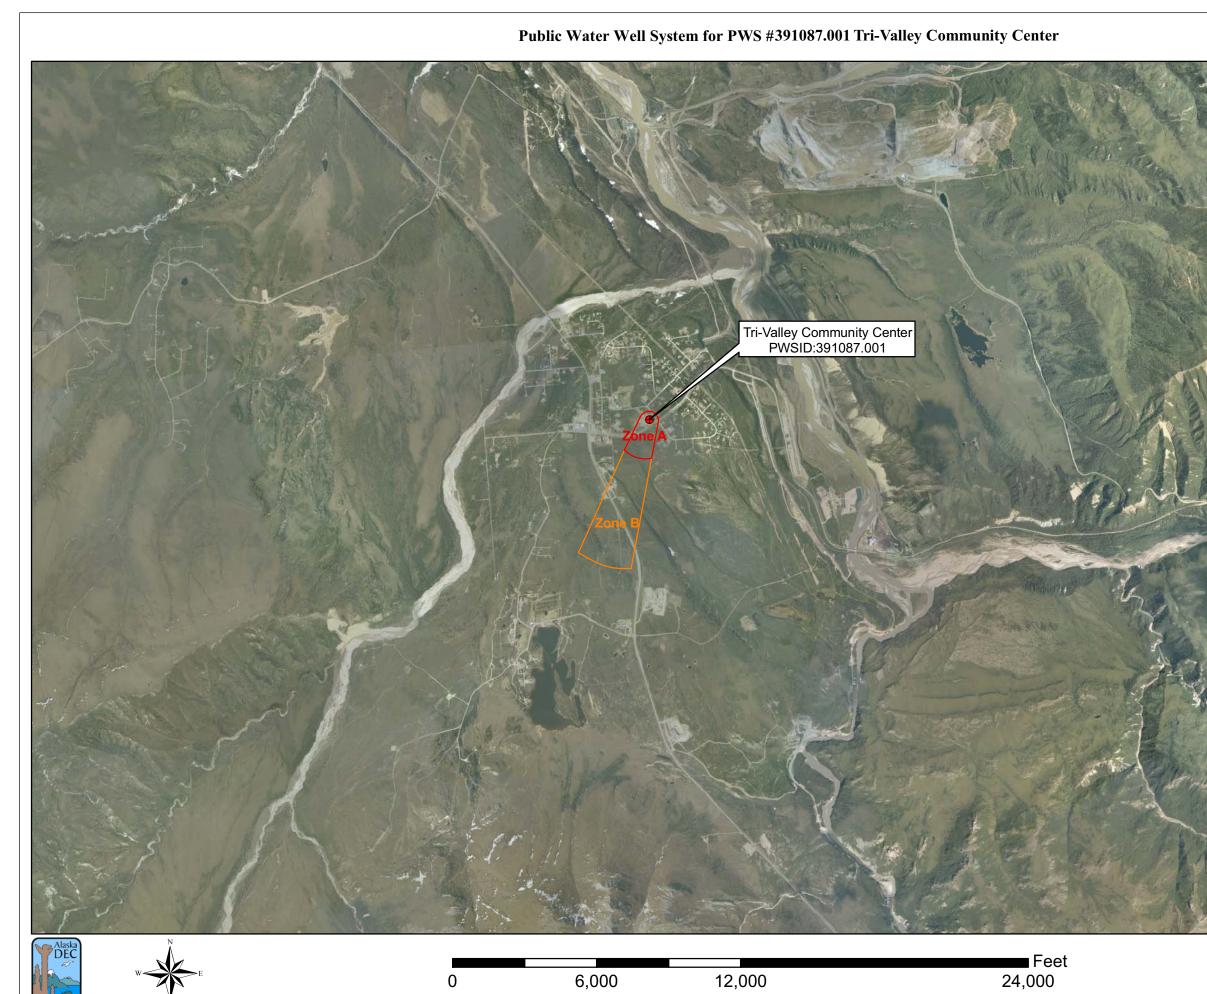

Legend
Class B Public Water System
Groundwater Protection Zones
Zone A Protection Area - Several Months Travel Time
Zone B Protection Area - 2 Years Travel Time
Data Sources: Contaminant Sources, Public Water System Wells, Alaska Department of Environmental Conservation (ADEC)
All other data: Alaska Statewide Digital Mapping Initiative (SDMI)
Drinking Water Protection Areas based on "Alaska Drinking Water Protection Program - Guidance Manual for Class B Public Water Systems" published by ADEC
URS Corporation does not guarantee the accuracy or validity of the data provided.
Inset 1 Area of Map Healy
McKinley Park

Tri-Valley Community Center PWS 391087.001

Appendix A Map A

APPENDIX B

Contaminant Source Inventory and Risk Ranking for Tri-Valley Community Center (Tables 1-4)

Contaminant Source Inventory for TRI-VALLEY COMMUNITY CENTER

Contaminant Source Type	Contaminant Source ID	CS ID tag	Zone	Map Number	Comments
Septic systems (serves one single-family home)	R02	R02	А	С	2 septic systems
Tanks, heating oil, residential (above ground)	R08	R08	А	С	2 heating oil tanks (assumed)
Highways and roads, paved (cement or asphalt)	X20	X20	А	С	2 Roads
Coal mining (active or inactive?)	E01	E01	В	С	
Highways and roads, paved (cement or asphalt)	X20	X20	В	С	1 Road

Table 2

Contaminant Source Inventory and Risk Ranking for TRI-VALLEY COMMUNITY CENTER

Sources of Bacteria and Viruses

Contaminant Source Type	Contaminant Source ID	CS ID tag	Zone	Risk Ranking for Analysis	Map Number	Comments
Septic systems (serves one single-family home)	R02	R02	А	Low	С	2 septic systems
Highways and roads, paved (cement or asphalt)	X20	X20	А	Low	С	2 Roads
Highways and roads, paved (cement or asphalt)	X20	X20	В	Low	С	1 Road

Table 3

Contaminant Source Inventory and Risk Ranking for TRI-VALLEY COMMUNITY CENTER

Sources of Nitrates/Nitrites

Contaminant Source Type	Contaminant Source ID	CS ID tag	Zone	Risk Ranking for Analysis	Map Number	Comments
Septic systems (serves one single-family home)	R02	R02	А	Low	С	2 septic systems
Highways and roads, paved (cement or asphalt)	X20	X20	А	Low	С	2 Roads
Highways and roads, paved (cement or asphalt)	X20	X20	В	Low	С	1 Road

Table 4

Contaminant Source Inventory and Risk Ranking for TRI-VALLEY COMMUNITY CENTER

PWSID 391087.001


Sources of Volatile Organic Chemicals

Contaminant Source Type	Contaminant Source ID	CS ID tag	Zone	Risk Ranking for Analysis	Map Number	Comments
Septic systems (serves one single-family home)	R02	R02	А	Low	С	2 septic systems
Tanks, heating oil, residential (above ground)	R08	R08	А	Medium	С	2 heating oil tanks (assumed)
Highways and roads, paved (cement or asphalt)	X20	X20	А	Low	С	2 Roads
Coal mining (active or inactive?)	E01	E01	В	High	С	
Highways and roads, paved (cement or asphalt)	X20	X20	В	Low	С	1 Road

APPENDIX C

Tri-Valley Community Center Drinking Water Protection Area and Potential and Existing Contaminant Sources (Map C)

Public Water Well System for PWS #391087.001 Tri-Valley Community Center Showing Potential and Existing Sources of Contamination

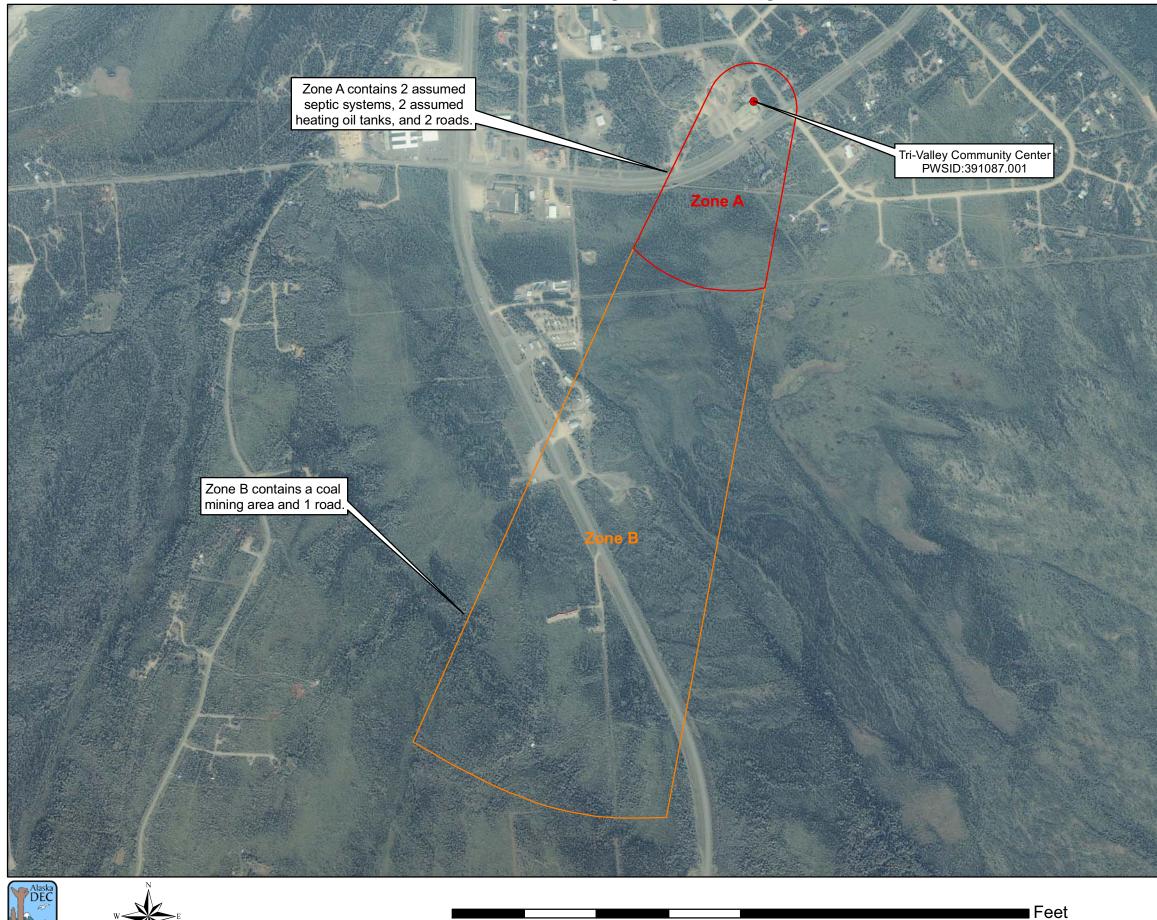


1,250

0

2,500

5,000

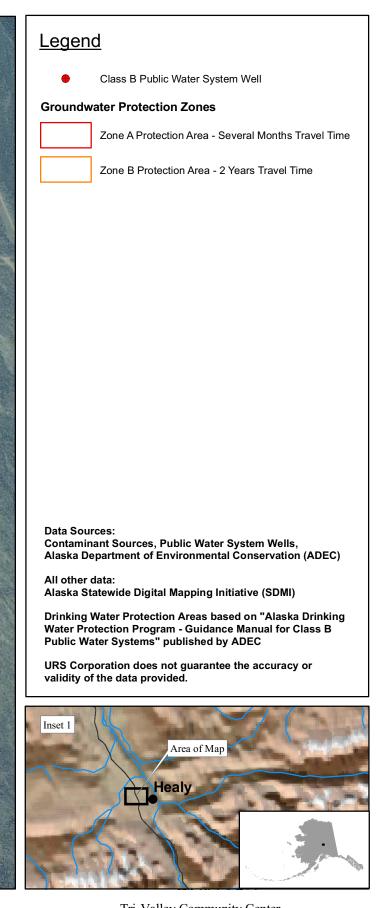

Tri-Valley Community Center PWS 391087.001 Appendix C Map C