

Source Water Assessment

A Hydrogeologic Susceptibility and Vulnerability Assessment for Decanter Inn Hotel Public Drinking Water System, Kasilof, Alaska PWSID # 249978.001

DRINKING WATER PROTECTION REPORT 1741

Alaska Department of Environmental Conservation

December, 2008

Source Water Assessment for Decanter Inn Hotel Public Drinking Water System Kasilof, Alaska PWSID# 249978.001

DRINKING WATER PROTECTION REPORT 1741

The Drinking Water Protection (DWP) section of the Drinking Water Program is producing Source Water Assessments in compliance with the Safe Drinking Water Act Amendments of 1996. Each assessment includes a delineation of the source water area, an inventory of potential and existing contaminant sources that may impact the water, a risk ranking for each of these contaminants, and an evaluation of the potential vulnerability of these drinking water sources.

These assessments are intended to provide public water systems owners/operators, communities, and local governments with the best available information that may be used to protect the quality of their drinking water. The assessments combine information obtained from various sources, including the U.S. Environmental Protection Agency, Alaska Department of Environmental Conservation (DEC), public water system owners/operators, and other public information sources. The results of this assessment are subject to change if additional data becomes available. It is anticipated this assessment will be updated every five years to reflect any changes in the vulnerability and/or susceptibility of public drinking water source. If you have any additional information that may affect the results of this assessment, please contact the DWP staff at the following number: 1-866-956-7656.

CONTENTS

		Page	Page			
		1	Vulnerability of Decanter Inn Hotel Drinking Water			
		ablic Drinking Water System 1	System3			
		rinking Water Protection Area 2	References			
-		and Existing Contaminant	Appendix A			
		2	Appendix B9			
Ranking of Cont	amin	ant Risks2	Appendix C11			
		TAB	LES			
			2			
			3			
			3			
Table 4. Overal	ll Vul	nerability	4			
APPENDIX	A.	APPEN Decanter Inn Hotel Drinking Water				
	B.	Contaminant Source Inventory for D Contaminant Source Inventory and I Viruses (Table 2)	Decanter Inn Hotel (Table 1) Risk Ranking for Decanter Inn Hotel – Bacteria and			
			Risk Ranking for Decanter Inn Hotel – Nitrates/Nitrites			
		Contaminant Source Inventory and I Chemicals (Table 4)	Risk Ranking for Decanter Inn Hotel – Volatile Organic			
	C.	Decanter Inn Hotel Drinking Water Sources (Map C)	Protection Area and Potential and Existing Contaminant			

Source Water Assessment for Decanter Inn Hotel Source of Public Drinking Water, Kasilof, Alaska

Drinking Water Protection Alaska Department of Environmental Conservation

EXECUTIVE SUMMARY

The public water system for Decanter Inn Hotel is a Class B (transient/non-community) water system consisting of one well located on the Sterling Highway, about 11 road miles south of Soldotna in Kasilof, Alaska. The wellhead received a susceptibility rating of Low and the aguifer received a susceptibility rating of Medium. Combining these two ratings produces a Low rating for the natural susceptibility of the well. Identified potential and current sources of contaminants for Decanter Inn Hotel public drinking water source include: assumed septic systems and assumed heating oil tanks. These identified potential and existing sources of contamination are considered as sources of bacteria and viruses, nitrates and/or nitrites, and volatile organic chemicals. Overall, the public water sources for Decanter Inn Hotel received a vulnerability rating of Low for bacteria and viruses, Low for nitrates and nitrites, and **Medium** for volatile organic chemicals. This assessment of contaminant risks can be used as a foundation for local voluntary protection efforts as well as a basis for the continuous efforts on the part of Decanter Inn Hotel to protect public health.

DECANTER INN HOTEL PUBLIC DRINKING WATER SYSTEM

Decanter Inn Hotel public water system is a Class B (transient/non-community) water system. The system consists of one well located on the Sterling Highway, in Kasilof, Alaska (see Map A in Appendix A). The community of Kasilof (population 596) is located approximately 12 miles southwest of the City of Kenai on the western edge of the Kenai Peninsula. It overlooks Cook Inlet, and is part of the Kenai Peninsula Borough, which has a population of approximately 50,000 and encompasses an area of more than 25,600 square miles (KPB, 2008).

The area receives 24 inches of rain annually, and average temperatures range from 14 to 27 degrees Fahrenheit in the winter and from 45 to 65 degrees Fahrenheit in the summer (ADCCED, 2008).

Most of the homes in Kasilof are fully plumbed, operating on private water wells and septic systems. Electricity is provided by the Homer Electric Association (ADCCED, 2008).

The Kenai Peninsula is divided into two distinct geographic regions: the Kenai Mountains to the east and the Kenai Lowlands to the west. The Kenai Lowlands are a glaciated coastal shelf approximately 100 miles long, bordered on the west and north by Cook Inlet and on the east by the northeast-trending Kenai Mountains. The Lowlands are predominately drained by the Kenai River and contain the communities of Sterling, Soldotna, Kenai, Nikiski, Clam Gulch, and Homer. The Kenai Mountains extend from the southern tip of the Peninsula north to Turnagain Arm, and include the communities of Hope, Moose Pass, Cooper Landing, and Seward (Karlstrom, 1964).

The most significant groundwater resources in the Kenai Lowlands are contained in coarse-grained sands and gravels. They are characterized by high rates of recharge, and are usually found in flood plain, river terrace, and alluvial deposits. Unsorted glacial moraine and drift deposits generally have poor groundwater yields, as do discontinuous layers of confining clays and silt that are common throughout unconsolidated cover. Unconsolidated sediment is more common in the northern portions of the Lowlands, where it locally hosts thicker, more extensive clay aquitards and multiple aquifers.

Most of the wells in the Kasilof area are deep, with depths ranging from 50 to 200 feet. Static water levels in many of these wells are between 10 and 30 feet below the surface. Although groundwater quality can vary significantly over short distances, groundwater supplies are generally abundant in the area. (The preceding summary of regional geology and hydrogeology is based on studies by: Bailey and Hogan (1995); Freethey and Scully (1980); Glass (1996); Hartmann, et al. (1972); and Karlstrom (1964).)

According to the well log, the well extends approximately 106 feet below the ground surface and is completed in a confined aquifer. The sanitary survey for this system (11/06/2007) states that the well has a sanitary seal installed and the well is grouted according to DEC regulations, but that the land surface is not appropriately sloped away from the well.

This system operates continuously and serves thirty non-residents and two residents through one service connection.

DECANTER INN HOTEL DRINKING WATER PROTECTION AREA

In order to evaluate whether a drinking water source is at risk, we must first evaluate what are the most likely pathways for surface contamination to reach the groundwater. These areas are determined by looking at the characteristics of the soil, groundwater, aquifer, and well.

The most probable area for contamination to reach the drinking water well is the drinking water protection area. The drinking water protection area is the area circling the well (the area influenced by pumping) and also the area upgradient of the well, usually forming a parabola shape. Because releases of contaminants within the protection area are most likely to impact the well, this area will serve as the focus for voluntary protection efforts.

There are many different methods for calculating the size of protection areas. Drinking Water Protection (DWP) uses a combination of two simple groundwater flow equations, the Thiem and uniform flow equations for all groundwater wells screened in unconsolidated material. The orientation of the protection zone is then drawn using a water table elevation map (if available) or a land surface elevation map of the area. The protection zone calculated by the DWP is an estimate using the available information and resources, and may differ slightly from the actual capture zone. Because of uncertainties and changing site conditions, a factor of safety is added to the protection zone to form the drinking water protection area for the well.

The parameters used to calculate the shape of this protection zone are general for the whole alluvial plain and were obtained from various United States Geological Survey (USGS) reports, area well logs, and the Groundwater textbook by Freeze and Cherry (Freeze and Cherry, 1979).

The protection areas established for wells by the DEC are usually separated into two zones, limited by the watershed. These zones correspond to differences in the time-of-travel (TOT) of the water moving through the aquifer to the well. An analytical calculation was used to determine the size and shape of the protection area.

The time-of-travel for contaminants within the water varies and is dependent on the physical and chemical characteristics of each contaminant. The following is a summary of the two protection area zones for wells and the calculated time-of-travel for each:

Table 1. Definition of Zones

Zone	Definition
A	Several months time-of-travel
В	Less than the 2 year time-of-travel

The drinking water protection area for Decanter Inn Hotel was determined using an analytical calculation and includes Zones A and B (see Map A in Appendix A).

INVENTORY OF POTENTIAL AND EXISTING CONTAMINANT SOURCES

DWP has completed an inventory of potential and existing sources of contamination within the Decanter Inn Hotel drinking water protection area. This inventory was completed through a search of agency records and other publicly available information. Potential sources of contamination to the drinking water aquifer include a wide range of categories and types. Potential drinking water contaminants are found within agricultural, residential, commercial, and industrial areas, but can also occur within areas that have little or no development.

For the basis of all Class B public water system assessments, the following three categories of drinking water contaminants were inventoried:

- Bacteria and viruses;
- Nitrates and/or nitrites:
- Volatile organic chemicals

The sources are displayed on Map C of Appendix C and summarized in Table 1 of Appendix B.

RANKING OF CONTAMINANT RISKS

Once the potential and existing sources of contamination have been identified, they are assigned a ranking according to what type and level of risk they represent. Ranking of contaminant risks for a "potential" or "existing" source of contamination is a function of toxicity and volumes of specific contaminants associated with that source. Rankings include:

- Low;
- Medium;
- High; and
- Very High.

Tables 2 through 4 in Appendix B contain the ranking of potential and existing sources of contamination with respect to bacteria and viruses, nitrates and/or nitrites, and volatile organic chemicals.

VULNERABILITY OF DECANTER INN HOTEL DRINKING WATER SYSTEM

Vulnerability of a drinking water source to contamination is a combination of two factors:

- Natural Susceptibility; and
- Contaminant Risks.

A score for the Natural Susceptibility of the well is reached by considering the properties of the well and the aquifer.

Susceptibility of the Wellhead (0-25 Points)

+
Susceptibility of the Aquifer (0-25 Points)

Natural Susceptibility of the Well (0-50 Points)

A ranking is assigned for the Natural Susceptibility according to the point score:

Natural Susceptibility Ratings						
40-50 pts	Very High					
30 to < 40 pts	High					
20 to < 30 pts	Medium					
< 20 pts	Low					

Factors contributing to the susceptibility of the wellhead are: whether the sanitary seal is in place, protection from flooding, and if the well casing is properly grouted.

The wellhead for the Decanter Inn Hotel received a **Low** susceptibility rating. The sanitary survey for this system (11/06/2007) states that the well has a sanitary seal installed and it is grouted according to DEC regulations, but that the land surface is not appropriately sloped away from the well. Sanitary seals prevent potential contaminants from entering the well, while sloping of the land surface away from the wellhead provides adequate surface water drainage, and concrete or grouting around the wellhead helps to prevent potential contaminants from traveling down the outside of the well casing.

Factors contributing to the susceptibility of the aquifer are: whether the aquifer is confined or unconfined, whether the well is completed in unconsolidated or fractured bedrock, whether wells and bore holes are penetrating the aquifer and, if applicable, the confining layer.

The Decanter Inn Hotel draws water from a confined well overlain by 61 feet of blue clay. Although the aquifer has a thick confining layer, it received a **Medium** susceptibility rating due to its relatively shallow upper limit (14 feet). While a thick confining layer provides a considerable barrier against contaminants penetrating the aquifer, its shallow nature makes it more susceptible by increasing its accessibility to contamination.

Table 2 summarizes the Susceptibility scores and ratings for the Decanter Inn Hotel system.

Table 2. Susceptibility

	Score	Rating
Susceptibility of the	5	Low
Wellhead		
Susceptibility of the	10	Medium
Aquifer		
Natural Susceptibility	15	Low

Contaminant risks are derived from an evaluation of the routine sampling results of the water system and the presence of potential sources of contamination.

Contaminant risks to a drinking water source depend on the type and distribution of contaminant sources. Flow charts are used to assign a point score, and ratings are assigned in the same way as for the natural susceptibility:

Contaminant Risk Ratings						
40-50 pts	Very High					
30 to < 40 pts	High					
20 to < 30 pts	Medium					
< 20 pts	Low					

Table 3 summarizes the Contaminant Risks for each category of drinking water contaminants for the Decanter Inn Hotel system.

Table 3. Contaminant Risks

Category	Score	Rating
Bacteria and Viruses	12	Low
Nitrates and/or Nitrites	12	Low
Volatile Organic Chemicals	25	Medium

Finally, an overall vulnerability score is assigned for each water system by combining each of the contaminant risk scores with the natural susceptibility score:

Natural Susceptibility (0-50 Points)

Contaminant Risks (0-50 Points)

Vulnerability of the Drinking Water Source to Contamination (0-100 Points)

Again, rankings are assigned according to a point score:

Overall Vulnerability Ratings						
80-100 pts	Very High					
60 to < 80 pts	High					
40 to < 60 pts	Medium					
< 40 pts	Low					

Table 4 contains the overall vulnerability scores (0-100) and ratings for each of the three categories of drinking water contaminants for the Decanter Inn Hotel system. Note: scores are rounded off to the nearest five.

Table 4. Overall Vulnerability

Category	Score	Rating
Bacteria and Viruses	25	Low
Nitrates and/or Nitrites	25	Low
Volatile Organic Chemicals	40	Medium

Bacteria and Viruses

The contaminant risk for bacteria and viruses is **Low** with assumed septic systems contributing to the risk to the drinking water well.

Coliforms (a bacteria) are found naturally in the environment and although they aren't necessarily a health threat, they are an indicator of other potentially harmful bacteria in the water, more specifically, fecal coliforms and E. coli, which only come from human and animal fecal waste. Harmful bacteria can cause diarrhea, cramps, nausea, headaches, or other symptoms (EPA, 2008).

Only a small amount of bacteria and viruses are required to endanger public health. Positive samples increase the overall vulnerability of the drinking water source, indicating that the source is susceptible to bacteria and virus contamination. Bacteria and viruses

have not been detected during recent water sampling at Decanter Inn Hotel (data reviewed in April, 2008).

After combining the contaminant risk for bacteria and viruses with the natural susceptibility of the well, the overall vulnerability of the well to contamination is **Low**.

Nitrates and Nitrites

The contaminant risk for nitrates and nitrites is **Low** with assumed septic systems contributing to the risk to the drinking water well.

The sampling history for Decanter Inn Hotel indicates that nitrates have not been detected in the water (data reviewed in April, 2008).

After combining the contaminant risk for nitrates and nitrites with the natural susceptibility of the well, the overall vulnerability of the well to contamination is **Low**.

Volatile Organic Chemicals

The contaminant risk for volatile organic chemicals is **Medium** with assumed septic systems and heating oil tanks contributing to the risk to the drinking water well.

The drinking water at Decanter Inn Hotel has not been recently sampled for volatile organic chemicals (data reviewed in April, 2008).

After combining the contaminant risk for volatile organic chemicals with the natural susceptibility of the well, the overall vulnerability of the well to contamination is **Medium**.

Using the Source Water Assessment

This assessment of contaminant risks can be used as a foundation for local voluntary protection efforts as well as a basis for the continuous efforts on the part of Decanter Inn Hotel to protect public health. It is anticipated that Source Water Assessments will be updated every five years to reflect any changes in the vulnerability and/or susceptibility of Decanter Inn Hotel drinking water source.


REFERENCES

- Alaska Department of Commerce, Community and Economic Development (ADCCED), Accessed 2008 [WWW document]. URL: http://www.commerce.state.ak.us/dca/commdb/CF COMDB.htm
- Bailey, B.J., and Hogan, E.V., 1995, Overview of environmental and hydrogeologic conditions near Kenai, Alaska. U.S. Geological Survey Open-File Report 95-410, 18 p.
- Freethey, G.W., and Scully, D.R., 1980, Water Resources of the Cook Inlet Basin, Alaska. U.S. Geological Survey Hydrologic Investigation Atlas HA-620, prepared in cooperation with Alaska Water Study Committee, State of Alaska Department of Natural Resources, and Division of Geological and Geophysical Surveys.
- Freeze, R.A. and Cherry, J.A., 1979. Groundwater. Prentice-Hall, Englewood Cliffs, NJ.
- Glass, Roy, L., 1996, Groundwater Conditions and Quality in the Western Part of the Kenai Peninsula, Southcentral Alaska. U.S. Geological Survey Open File Report 94-466, prepared in cooperation with the Alaska Department of Natural Resources, Kenai Peninsula Borough, and Kenai Soil and Water Conservation District.
- Hartman, D.C., Pessel, G.H., and McGee, D.I., 1972, Kenai Group of Cook Inlet Basin, Alaska: State of Alaska. Open File Report #49, Department of Natural Resources Division of Geological and Geophysical Surveys, 5p.
- Karlstrom, T.N.V., 1964, Quaternary geology of the Kenai Lowland and glacial history of the Cook Inlet region, Alaska. U.S. Geological Survey Professional Paper 443, 64 p.
- Kenai Peninsula Borough (KPB), Accessed 2008 [WWW document]. URL: http://www.borough.kenai.ak.us/.
- United States Environmental Protection Agency (EPA), Accessed 2008 [WWW document]. URL: http://www.epa.gov/safewater/contaminants/index.html.

APPENDIX A

Decanter Inn Hotel Drinking Water Protection Area Location Map (Map A)

Public Water Well System for PWS #249978.001 Decanter Inn Hotel

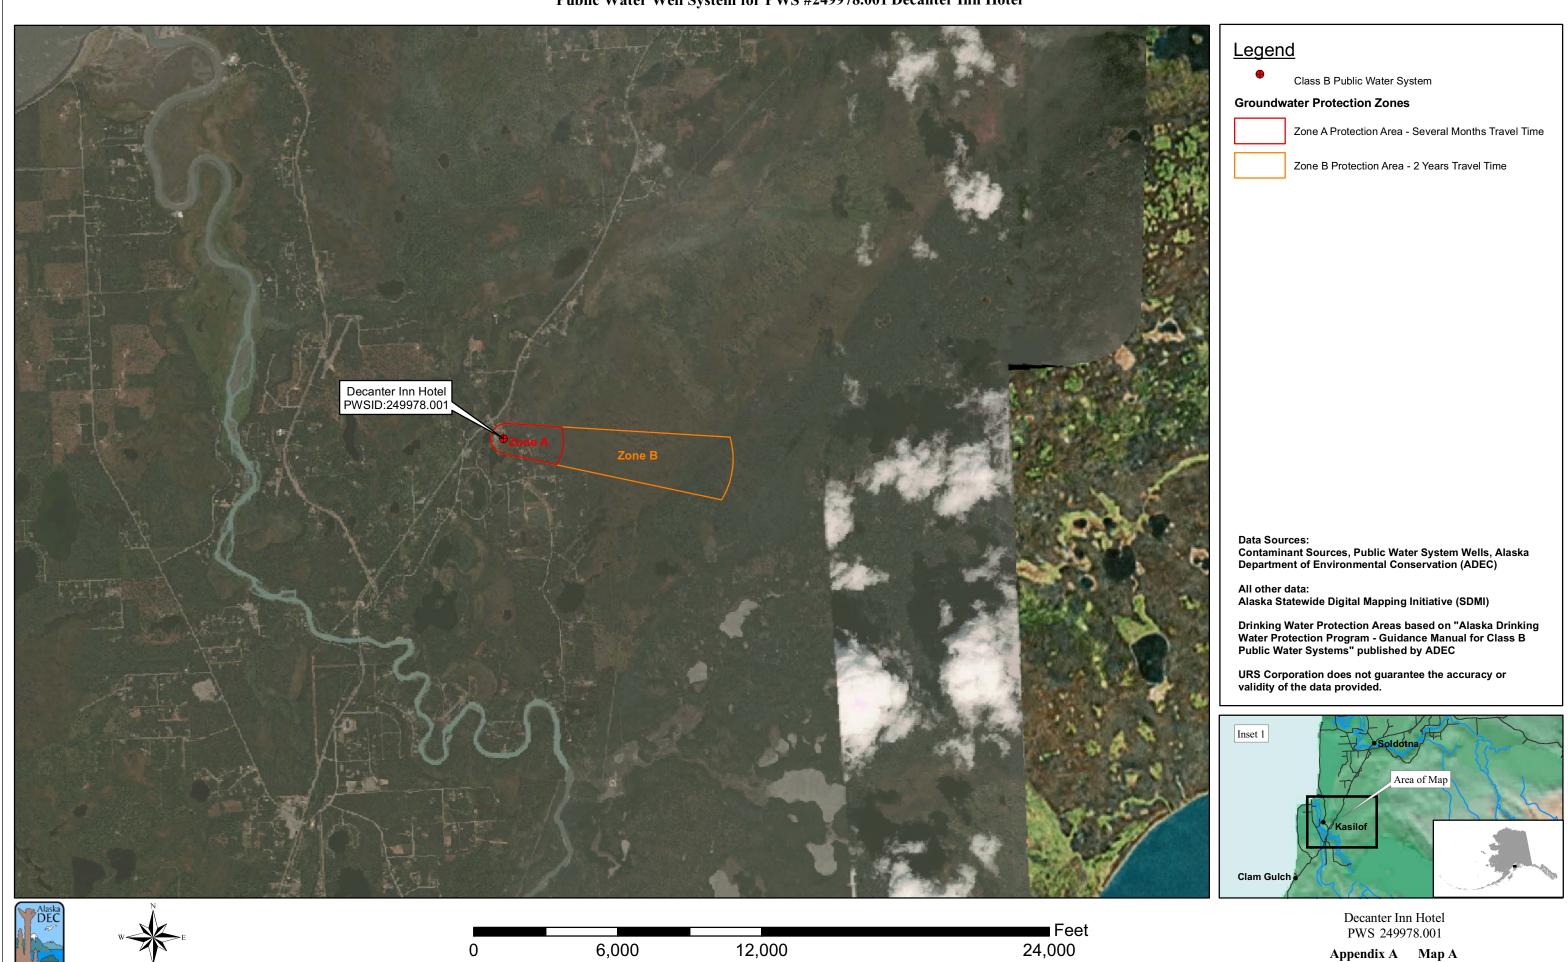

APPENDIX B

Contaminant Source Inventory and Risk Ranking for Decanter Inn Hotel (Tables 1-4)

Table 1

Contaminant Source Inventory for DECANTER INN HOTEL

Contaminant Source Type	Contaminant Source ID	CS ID tag	Zone	Map Number	Comments
Septic systems (serves one single-family home)	R02	R02	A	С	6 inferred
Tanks, heating oil, residential (above ground)	R08	R08	A	С	6 assumed

Table 2

Contaminant Source Inventory and Risk Ranking for DECANTER INN HOTEL

PWSID 249978.001

Sources of Bacteria and Viruses

Contaminant Source Type	Contaminant Source ID	CS ID tag	Zone	Risk Ranking for Analysis	Map Number	Comments
Septic systems (serves one single-family home)	R02	R02	A	Low	С	6 inferred

Table 3

Contaminant Source Inventory and Risk Ranking for DECANTER INN HOTEL

PWSID 249978.001

Sources of Nitrates/Nitrites

Contaminant Source Type	Contaminant Source ID	CS ID tag	Zone	Risk Ranking for Analysis	Map Number	Comments
Septic systems (serves one single-family home)	R02	R02	A	Low	С	6 inferred

Contaminant Source Inventory and Risk Ranking for DECANTER INN HOTEL

PWSID 249978.001

Sources of Volatile Organic Chemicals

Contaminant Source Type	Contaminant Source ID	CS ID tag	Zone	Risk Ranking for Analysis	Map Number	Comments	
Septic systems (serves one single-family home)	R02	R02	A	Low	С	6 inferred	
Tanks, heating oil, residential (above ground)	R08	R08	A	Medium	C	6 assumed	

APPENDIX C

Decanter Inn Hotel Drinking Water Protection Area and Potential and Existing Contaminant Sources (Map C)

Public Water Well System for PWS #249978.001 Decanter Inn Hotel Showing Potential and Existing Sources of Contamination

