

Source Water Assessment

A Hydrogeologic Susceptibility and Vulnerability Assessment for 229 Parks Highway Restaurant Public Drinking Water System, McKinley Park, Alaska PWSID # 391922.001

DRINKING WATER PROTECTION REPORT 1840

Alaska Department of Environmental Conservation

January, 2009

Source Water Assessment for 229 Parks Highway Restaurant Public Drinking Water System McKinley Park, Alaska PWSID# 391922.001

DRINKING WATER PROTECTION REPORT 1840

The Drinking Water Protection (DWP) section of the Drinking Water Program is producing Source Water Assessments in compliance with the Safe Drinking Water Act Amendments of 1996. Each assessment includes a delineation of the source water area, an inventory of potential and existing contaminant sources that may impact the water, a risk ranking for each of these contaminants, and an evaluation of the potential vulnerability of these drinking water sources.

These assessments are intended to provide public water systems owners/operators, communities, and local governments with the best available information that may be used to protect the quality of their drinking water. The assessments combine information obtained from various sources, including the U.S. Environmental Protection Agency, Alaska Department of Environmental Conservation (DEC), public water system owners/operators, and other public information sources. The results of this assessment are subject to change if additional data becomes available. It is anticipated this assessment will be updated every five years to reflect any changes in the vulnerability and/or susceptibility of public drinking water source. If you have any additional information that may affect the results of this assessment, please contact the DWP staff at the following number: 1-866-956-7656.

January, 2009

CONTENTS

Page
Executive Summary1
229 Parks Highway Restaurant Public Drinking Water
System1
229 Parks Highway Restaurant Drinking Water
Protection Area1
Inventory of Potential and Existing Contaminant
Sources

	Page
Ranking of Contaminant Risks	2
Vulnerability of 229 Parks Highway Restaurant	
Drinking Water System	2
References	5
Appendix A	7
Appendix B	9
Appendix C	

TABLES

Table 1.	Definition of Zones	2
Table 2.	Susceptibility	3
Table 3.	Contaminant Risks	3
Table 4.	Overall Vulnerability	3

APPENDICES

APPENDIX

A. 229 Parks Highway Restaurant Drinking Water Protection Area (Map A)

- B. Contaminant Source Inventory for 229 Parks Highway Restaurant (Table 1) Contaminant Source Inventory and Risk Ranking for 229 Parks Highway Restaurant – Bacteria and Viruses (Table 2) Contaminant Source Inventory and Risk Ranking for 229 Parks Highway Restaurant – Nitrates/Nitrites (Table 3) Contaminant Source Inventory and Risk Ranking for 229 Parks Highway Restaurant – Volatile Organic Chemicals (Table 4)
- C. 229 Parks Highway Restaurant Drinking Water Protection Area and Potential and Existing Contaminant Sources (Map C)

Source Water Assessment for 229 Parks Highway Restaurant Source of Public Drinking Water, McKinley Park, Alaska

Drinking Water Protection Alaska Department of Environmental Conservation

EXECUTIVE SUMMARY

The public water system for 229 Parks Highway Restaurant is a Class B (transient/non-community) water system consisting of one well at Mile 229.7 of the Parks Highway, approximately one mile south of McKinley Park, Alaska. The wellhead received a susceptibility rating of Low and the aquifer received a susceptibility rating of Very High. Combining these two ratings produces a **Medium** rating for the natural susceptibility of the well. Identified potential and current sources of contaminants for 229 Parks Highway Restaurant public drinking water source include an airport and roads. These identified potential and existing sources of contamination are considered as sources of bacteria and viruses, nitrates and/or nitrites, and volatile organic chemicals. Overall, the public water sources for 229 Parks Highway Restaurant received a vulnerability rating of Low for bacteria and viruses, Medium for nitrates and nitrites, and High for volatile organic chemicals. This assessment of contaminant risks can be used as a foundation for local voluntary protection efforts as well as a basis for the continuous efforts on the part of 229 Parks Highway Restaurant to protect public health.

229 PARKS HIGHWAY RESTAURANT PUBLIC DRINKING WATER SYSTEM

229 Parks Highway Restaurant public water system is a Class B (transient/non-community) water system. The system consists of one well at mile post 229.7 on the Parks Highway, approximately one mile south of McKinley Park, Alaska. McKinley Park, population 149, is part of the Denali Borough. Average temperatures range from -22 in January, to 72 in July. Average annual rainfall is 12.7 inches. A majority of the homes haul water, use outhouses, and are not plumbed. Refuse is hauled to the Borough regional landfill (ADCCED, 2008).

According to the sanitary survey (11/10/2005), the well extends approximately 237 feet below the ground surface. No well log is available, so the well is assumed to be completed in an unconfined, fractured bedrock aquifer based on information from nearby public water systems. The sanitary survey also states that the land surface is appropriately sloped away from the well, the well is grouted according to DEC regulations, and a sanitary seal is installed.

This system operates full-time from May to September and part-time throughout the winter. It serves three residents and one hundred and seven non-residents through fourteen service connections.

229 PARKS HIGHWAY RESTAURANT DRINKING WATER PROTECTION AREA

In order to evaluate whether a drinking water source is at risk, we must first evaluate what are the most likely pathways for surface contamination to reach the groundwater. These areas are determined by looking at the characteristics of the soil, groundwater, aquifer, and well.

The most probable area for contamination to reach the drinking water well is the drinking water protection area. The drinking water protection area is the area circling the well (the area influenced by pumping) and also the area upgradient of the well, usually forming a parabola shape. Because releases of contaminants within the protection area are most likely to impact the well, this area will serve as the focus for voluntary protection efforts.

There are many different methods for calculating the size of protection areas. Drinking Water Protection (DWP) uses a combination of two simple groundwater flow equations, the Thiem and uniform flow equations for all groundwater wells screened in unconsolidated material. The orientation of the protection zone is then drawn using a water table elevation map (if available) or a land surface elevation map of the area. The protection zone calculated by the DWP is an estimate using the available information and resources, and may differ slightly from the actual capture zone. Because of uncertainties and changing site conditions, a factor of safety is added to the protection zone to form the drinking water protection area for the well.

The parameters used to calculate the shape of this protection zone are general for the whole alluvial plain and were obtained from various United States Geological Survey (USGS) reports, area well logs, and the Groundwater textbook by Freeze and Cherry (Freeze and Cherry, 1979). The protection areas established for wells by the DEC are usually separated into two zones, limited by the watershed. These zones correspond to differences in the time-of-travel (TOT) of the water moving through the aquifer to the well. An analytical calculation was used to determine the size and shape of the protection area.

The time-of-travel for contaminants within the water varies and is dependent on the physical and chemical characteristics of each contaminant. The following is a summary of the two protection area zones for wells and the calculated time-of-travel for each:

Table 1. Definition of Zones

Zone	Definition
А	Several months time-of-travel
В	Less than the 2 year time-of-travel

The drinking water protection area for 229 Parks Highway Restaurant was determined using an analytical calculation and includes Zones A and B (see Map A of Appendix A).

INVENTORY OF POTENTIAL AND EXISTING CONTAMINANT SOURCES

DWP has completed an inventory of potential and existing sources of contamination within the 229 Parks Highway Restaurant drinking water protection area. This inventory was completed through a search of agency records and other publicly available information. Potential sources of contamination to the drinking water aquifer include a wide range of categories and types. Potential drinking water contaminants are found within agricultural, residential, commercial, and industrial areas, but can also occur within areas that have little or no development.

For the basis of all Class B public water system assessments, the following three categories of drinking water contaminants were inventoried:

- Bacteria and viruses;
- Nitrates and/or nitrites;
- Volatile organic chemicals

The sources are displayed on Map C of Appendix C and summarized in Table 1 of Appendix B.

RANKING OF CONTAMINANT RISKS

Once the potential and existing sources of contamination have been identified, they are assigned a ranking according to what type and level of risk they represent. Ranking of contaminant risks for a "potential" or "existing" source of contamination is a function of toxicity and volumes of specific contaminants associated with that source. Rankings include:

- Low;
- Medium;
- High; and
- Very High.

Tables 2 through 4 in Appendix B contain the ranking of potential and existing sources of contamination with respect to bacteria and viruses, nitrates and/or nitrites, and volatile organic chemicals.

VULNERABILITY OF 229 PARKS HIGHWAY RESTAURANT DRINKING WATER SYSTEM

Vulnerability of a drinking water source to contamination is a combination of two factors:

- Natural Susceptibility; and
- Contaminant Risks.

A score for the Natural Susceptibility of the well is reached by considering the properties of the well and the aquifer.

> Susceptibility of the Wellhead (0-25 Points) + Susceptibility of the Aquifer (0-25 Points) =

Natural Susceptibility of the Well (0-50 Points)

A ranking is assigned for the Natural Susceptibility according to the point score:

Natural Susceptibility Ratings				
40-50 pts	Very High			
30 to < 40 pts	High			
20 to < 30 pts	Medium			
< 20 pts	Low			
	40-50 pts 30 to < 40 pts 20 to < 30 pts			

Factors contributing to the susceptibility of the wellhead are: whether the sanitary seal is in place, protection from flooding, and if the well casing is properly grouted.

The wellhead for the 229 Parks Highway Restaurant received a **Low** susceptibility rating. The most recent sanitary survey states that the land surface is appropriately sloped away from the well, the well is grouted according to DEC regulations, and a sanitary seal is installed. Sanitary seals prevent potential contaminants from entering the well, while sloping of the land surface away from the wellhead provides adequate surface water drainage, and concrete or grouting around the wellhead helps to prevent potential

contaminants from traveling down the outside of the well casing.

Factors contributing to the susceptibility of the aquifer are: whether the aquifer is confined or unconfined, whether the well is completed in unconsolidated or fractured bedrock, whether wells and bore holes are penetrating the aquifer and, if applicable, the confining layer.

No well log is available for the 229 Parks Highway Restaurant system, therefore it is assumed to draw water from an unconfined fractured bedrock aquifer based on information from nearby public water systems. The aquifer received a **Very High** susceptibility rating because of its unconfined, fractured bedrock nature and the presence of another well penetrating the vadose zone of the protection area. Because a fractured bedrock aquifer is recharged by surface water and precipitation that migrates downward from the surface, it is susceptible to contamination from outside sources. Furthermore, the presence of another well penetrating the vadose zone of the protection area can allow contaminants to travel into the shared aquifer with precipitation and runoff.

Table 2 summarizes the Susceptibility scores and ratings for the 229 Parks Highway Restaurant system.

Table 2. Susceptibility

	Score	Rating
Susceptibility of the	0	Low
Wellhead		
Susceptibility of the	25	Very High
Aquifer		
Natural Susceptibility	25	Medium

Contaminant risks are derived from an evaluation of the routine sampling results of the water system and the presence of potential sources of contamination. Contaminant risks to a drinking water source depend on the type and distribution of contaminant sources. Flow charts are used to assign a point score, and ratings are assigned in the same way as for the natural susceptibility:

Contaminant Risk Ratings		
40-50 pts	Very High	
30 to < 40 pts	High	
20 to < 30 pts	Medium	
< 20 pts	Low	

Table 3 summarizes the Contaminant Risks for each category of drinking water contaminants for the 229 Parks Highway Restaurant system.

Table 3. Contaminant Risks

Category	Score	Rating
Bacteria and Viruses	12	Low
Nitrates and/or Nitrites	15	Low
Volatile Organic Chemicals	40	Very High

Finally, an overall vulnerability score is assigned for each water system by combining each of the contaminant risk scores with the natural susceptibility score:

> Natural Susceptibility (0-50 Points) + Contaminant Risks (0-50 Points) =

Vulnerability of the Drinking Water Source to Contamination (0-100 Points)

Again, rankings are assigned according to a point score:

Overall Vulnera	bility Ratings
80-100 pts	Very High
60 to < 80 pts	High
40 to < 60 pts	Medium
< 40 pts	Low

Table 4 contains the overall vulnerability scores (0-100) and ratings for each of the three categories of drinking water contaminants for the 229 Parks Highway Restaurant system. Note: scores are rounded off to the nearest five.

Table 4. Overall Vulnerability

Category	Score	Rating
Bacteria and Viruses	35	Low
Nitrates and/or Nitrites	40	Medium
Volatile Organic Chemicals	65	High

Bacteria and Viruses

The contaminant risk for bacteria and viruses is **Low** with roads contributing the only risk to the drinking water well.

Coliforms (a bacteria) are found naturally in the environment and although they aren't necessarily a health threat, they are an indicator of other potentially harmful bacteria in the water, more specifically, fecal coliforms and E. coli, which only come from human and animal fecal waste. Harmful bacteria can cause diarrhea, cramps, nausea, headaches, or other symptoms (EPA, 2008).

Only a small amount of bacteria and viruses are required to endanger public health. Positive samples increase the overall vulnerability of the drinking water source, indicating that the source is susceptible to bacteria and virus contamination. Bacteria and viruses have not been detected during recent sampling at 229 Parks Highway Restaurant (data reviewed in April, 2008).

After combining the contaminant risk for bacteria and viruses with the natural susceptibility of the well, the overall vulnerability of the well to contamination is **Low**.

Nitrates and Nitrites

The contaminant risk for nitrates and nitrites is **Low** with roads and an airport contributing to the risk to the drinking water well.

The sampling history for 229 Parks Highway Restaurant indicates that nitrates have been detected in the water within the last five years of sampling, with the highest concentration of 0.585 mg/l detected on 04/18/2005 (data reviewed in April, 2008).

After combining the contaminant risk for nitrates and nitrites with the natural susceptibility of the well, the overall vulnerability of the well to contamination is **Medium**.

Volatile Organic Chemicals

The contaminant risk for volatile organic chemicals is **Very High** with roads and an airport contributing to the risk to the drinking water well.

The drinking water at 229 Parks Highway Restaurant has not been recently sampled for volatile organic chemicals data reviewed in April, 2008).

After combining the contaminant risk for volatile organic chemicals with the natural susceptibility of the well, the overall vulnerability of the well to contamination is **High**.

Using the Source Water Assessment

This assessment of contaminant risks can be used as a foundation for local voluntary protection efforts as well as a basis for the continuous efforts on the part of 229 Parks Highway Restaurant to protect public health. It is anticipated that Source Water Assessments will be updated every five years to reflect any changes in the vulnerability and/or susceptibility of 229 Parks Highway Restaurant drinking water source.

REFERENCES


Alaska Department of Commerce,Community and Economic Development (ADCCED), Accessed 2008 [WWW document]. URL: http://www.commerce.state.ak.us/dca/commdb/CF_COMDB.htm

Freeze, R.A. and Cherry, J.A., 1979. Groundwater. Prentice-Hall, Englewood Cliffs, NJ.

United States Environmental Protection Agency (EPA), Accessed 2008 [WWW document]. URL: http://www.epa.gov/safewater/contaminants/index.html.

APPENDIX A

229 Parks Highway Restaurant Drinking Water Protection Area Location Map (Map A)

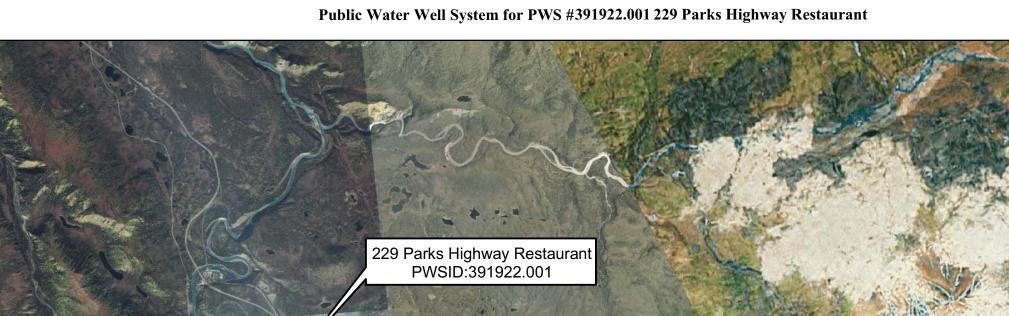

100		- Shi		
Alaska DEC W				Feet
	0	10,000	20,000	40,000

	Legend
	Class B Public Water System
	Groundwater Protection Zones
	Zone A Protection Area - Several Months Travel Time
	Zone B Protection Area - 2 Years Travel Time
Sale of the second seco	
E.	
1	
10.00	
5	
	Data Sources: Contaminant Sources, Public Water System Wells, Alaska
	Department of Environmental Conservation (ADEC)
10	All other data: Alaska Statewide Digital Mapping Initiative (SDMI)
NUN	Drinking Water Protection Areas based on "Alaska Drinking Water Protection Program - Guidance Manual for Class B Public Water Systems" published by ADEC
	URS Corporation does not guarantee the accuracy or validity of the data provided.
1	
11	Inset 1 McKinley Park Area of Map
and and	
6 2	
STALL STALL	
	229 Parks Highway Restaurant

229 Parks Highway Restauran PWS 391922.001

Appendix A Map A

APPENDIX B

Contaminant Source Inventory and Risk Ranking for 229 Parks Highway Restaurant (Tables 1-4)

Contaminant Source Type	Contaminant Source ID	CS ID tag	Zone	Map Number	Comments
Airports	X14	X14-01	А	С	Denali Landing Strip
Highways and roads, paved (cement or asphalt)	X20	X20	А	С	

Contaminant Source Inventory and Risk Ranking for 229 PARKS HIGHWAY RESTAURANT

Sources of Bacteria and Viruses

Contaminant Source Type	Contaminant Source ID	CS ID tag	Zone	Risk Ranking for Analysis	Map Number	Comments
Highways and roads, paved (cement or asphalt)	X20	X20	А	Low	С	

Contaminant Source Inventory and Risk Ranking for 229 PARKS HIGHWAY RESTAURANT

PWSID 391922.001

Sources of Nitrates/Nitrites

Contaminant Source Type	Contaminant Source ID	CS ID tag	Zone	Risk Ranking for Analysis	Map Number	Comments
Airports	X14	X14-01	А	Low	С	Denali Landing Strip
Highways and roads, paved (cement or asphalt)	X20	X20	А	Low	С	

Contaminant Source Inventory and Risk Ranking for 229 PARKS HIGHWAY RESTAURANT

PWSID 391922.001


Sources of Volatile Organic Chemicals

Contaminant Source Type	Contaminant Source ID	CS ID tag	Zone	Risk Ranking for Analysis	Map Number	Comments
Airports	X14	X14-01	А	High	С	Denali Landing Strip
Highways and roads, paved (cement or asphalt)	X20	X20	А	Low	С	

APPENDIX C

229 Parks Highway Restaurant Drinking Water Protection Area and Potential and Existing Contaminant Sources (Map C)

Public Water Well System for PWS #391922.001 229 Parks Highway Restaurant Showing Potential and Existing Sources of Contamination

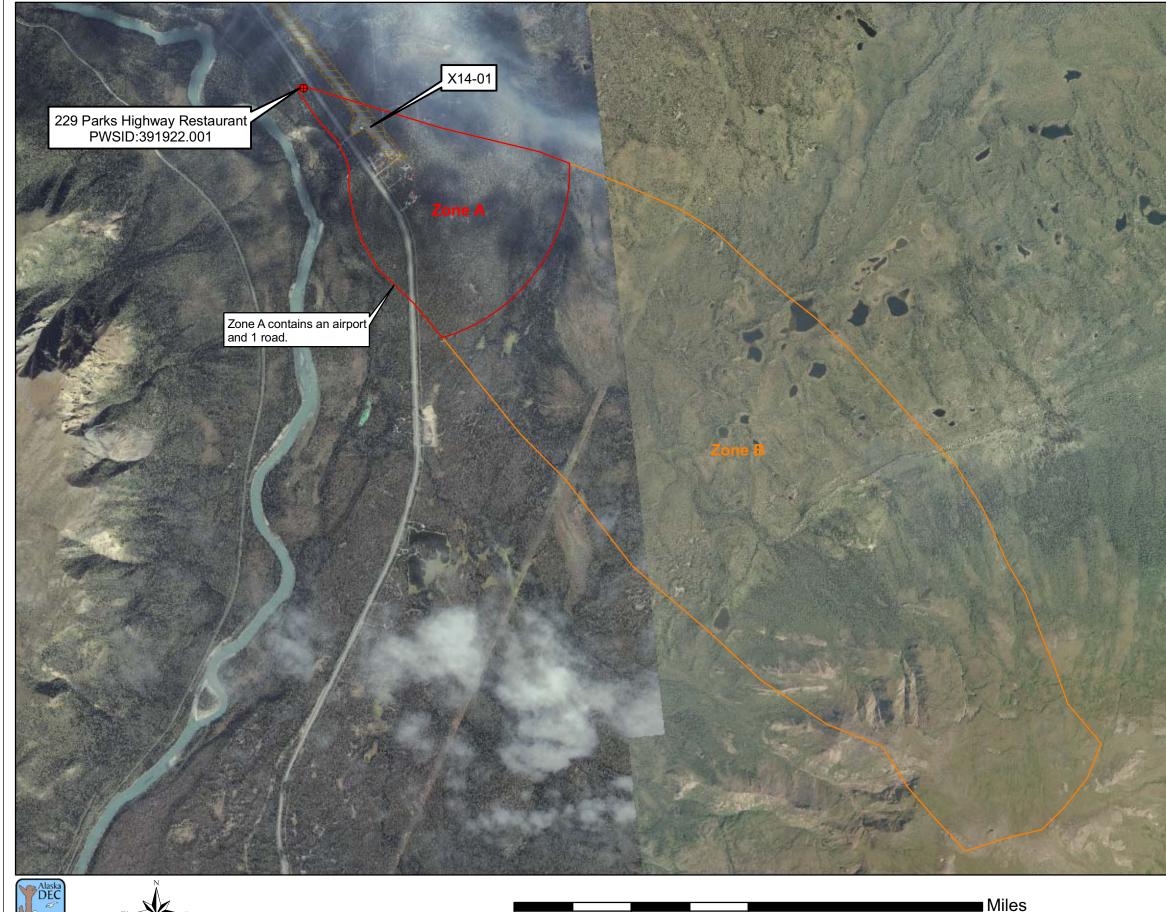


0

0.5

1

2

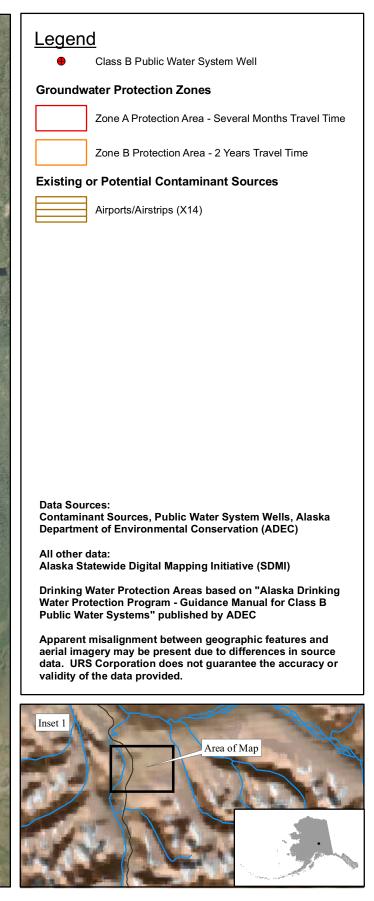

229 Parks Highway Restaurant PWS 391922.001

Appendix C Map C