

Source Water Assessment

A Hydrogeologic Susceptibility and Vulnerability Assessment for Upper Troublesome Creek Campground Drinking Water System, Mile 137.6 Parks Highway, Alaska Upper Troublesome Creek Campground #223797

DRINKING WATER PROTECTION PROGRAM REPORT 234 Alaska Department of Environmental Conservation

AUGUST 2002

Source Water Assessment for Upper Troublesome Creek Campground Drinking Water System, Mile 137.6 Parks Highway, Alaska Upper Troublesome Creek Campground #223797

By Shannon & Wilson, Inc.

DRINKING WATER PROTECTION PROGRAM REPORT 234

The Drinking Water Protection Program is producing Source Water Assessments in compliance with the Safe Drinking Water Act Amendments of 1996. Each assessment includes a delineation of the source water area, an inventory of potential and existing contaminant sources that may impact the water, a risk ranking for each of these contaminants, and an evaluation of the potential vulnerability of these drinking water sources.

These assessments are intended to provide public water systems owners/operators, communities, and local governments with the best available information that may be used to protect the quality of their drinking water. The assessments combine information obtained from various sources, including the U.S. Environmental Protection Agency, Alaska Department of Environmental Conservation (ADEC), public water system owners/operators, and other public information sources. The results of this assessment are subject to change if additional data becomes available. If you have any additional information that may affect the results of this assessment, please contact the Program Coordinator of DWPP, (907) 269-7521.

CONTENTS

	Page		Page
Executive Summary	ĩ	Inventory of Potential and Existing	
Introduction	1	Contaminant Sources	3
Description of the Middle Susitna River Region	2	Ranking of Contaminant Risks	3
Upper Troublesome Creek Campground Public		Vulnerability of Troublesome Creek	
Drinking Water System	2	Campground Drinking Water Source	3
Upper Troublesome Creek Campground	-	Summary	4
Protection Area	2	References Cited	6
1 loteetion / neu	-		

TABLES

Table 1 - Definition of Zones	3
Table 2 - Natural Susceptibility - Susceptibility of the Wellhead and Aquifer to Contamination	4
Table 3 - Contaminant Risks	4
Table 4 - Overall Vulnerability of Upper Troublesome Creek Campground to Contamination by Category	4

ILLUSTRATIONS

		Page
FIGURE	1. Index map showing the location of the Middle Susitna River Region	1

APPENDICES

APPENDIX A. Upper Troublesome Creek Campground Drinking Water Protection Area (Map 1)

B. Contaminant Source Inventory for Upper Troublesome Creek Campground (Table 1)
Contaminant Source Inventory and Risk Ranking for Upper Troublesome Creek
Campground – Bacteria and Viruses (Table 2)
Contaminant Source Inventory and Risk Ranking for Upper Troublesome Creek

D- ---

- Campground Nitrates/Nitrites (Table 3)
- Contaminant Source Inventory and Risk Ranking for Upper Troublesome Creek Campground – Volatile Organic Chemicals (Table 4)
- C. Upper Troublesome Creek Campground Drinking Water Protection Area and Potential and Existing Contaminant Sources (Map 2)
- D. Vulnerability Analysis for Contaminant Source Inventory and Risk Ranking for Upper Troublesome Creek Campground Public Drinking Water Source (Charts 1 – 8)

Source Water Assessment for Upper Troublesome Creek Campground Source of Public Drinking Water, Mile 137.6 Parks Highway, Alaska

By Shannon & Wilson, Inc.

Drinking Water Protection Program Alaska Department of Environmental Conservation

EXECUTIVE SUMMARY

The Upper Troublesome Creek Campground is a Class B (transient/non-community) water system consisting of one well, located at Mile 137.6 of the Parks Highway. Identified potential and current sources of contaminants for Upper Troublesome Creek Campground public drinking water source include: gravel roads and non-residential pit toilets. These identified potential and existing sources of contamination are considered sources of bacteria and viruses, nitrates and/or nitrites, and volatile organic chemicals. Overall, the public water sources for Upper Troublesome Creek Campground received а vulnerability rating of Low for volatile organic chemicals, Low for bacteria and viruses, and Low for nitrates and nitrites.

INTRODUCTION

The Alaska Department of Environmental Conservation (ADEC) is completing source water assessments for all public drinking water sources in the State of Alaska. The purpose of this assessment is to provide owners and/or operators, communities, and local governments with information they can use to preserve the quality of Alaska's public drinking water supplies. The results of this source water assessment can be used to decide where voluntary protection efforts are needed and feasible, and also what efforts will be most effective in reducing contaminant risks to your water system. Shannon & Wilson has been contracted to perform these assessments under the supervision of ADEC.

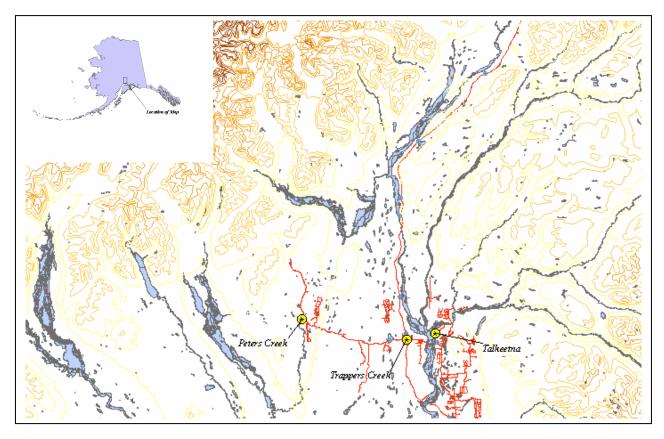


Figure 1. Index map showing the location of the Middle Susitna River Region.

This source water assessment combines a review of the natural conditions at the site and the potential and existing contaminant risks. These are combined to determine the overall vulnerability of the drinking water source to contamination.

DESCRIPTION OF THE MIDDLE SUSITNA RIVER REGION

Location

The Susitna River watershed is the largest watershed in Southcentral Alaska with the community of Talkeetna located at the confluence of the Chulitna, Talkeetna, and Susitna rivers. The area surrounding Talkeetna is shown in Figure 1. Talkeetna is located in the Matanuska-Susitna (Mat-Su) Borough.

Glacial and alluvial forces have shaped the Susitna River Region surrounding Talkeetna. These forces have resulted in the broad U-shaped river valleys, lakes, streams and undulating ridges and hills. Landforms in and around the Middle Susitna River Region are typified by the broad river floodplains, low ridges and lowlands.

Precipitation

Talkeetna averages about 30 inches of precipitation per year, including about 107 inches of snowfall.

Topography and Drainage

The area topography varies from about 300 feet to 400 feet within the river floodplains to several thousand feet on the surrounding ridges and mountain flanks.

Groundwater

Although the quality can vary significantly in a short distance, groundwater supplies are generally abundant in the area. Many homes and businesses in the area rely on individual wells for their water supply. Most of these wells are shallow with depths of less than 100 feet to 200 feet. Static water levels in many of these wells are less than 15 feet below the surface. The coarse, alluvial, sandy gravel in the floodplains of the areas streams and rivers provides a large aquifer even in the winter when infiltration is low.

Geology and Soils

Most of the soils in the area provide good sources of sand, gravel and topsoil. The deposition of silt, clay and organic muck in old lakes, oxbows and depressions means that some areas have soil conditions that vary over relatively short distances.

UPPER TROUBLESOME CREEK PUBLIC DRINKING WATER SYSTEM

Upper Troublesome Creek Campground is a Class B (transient/non-community) water system. The system consists of one well at Mile 137.6 of the Parks Highway.

According to the well log completed for the water system, installation of the well occurred on November 10, 1983, to a total depth of approximately 101 feet below ground surface and was completed with 6-inch well casing. The most recent Sanitary Survey (8/25/99) indicates the well was installed with a cap providing a sanitary seal. A properly installed sanitary seal may provide protection against contaminants from entering the source waters at the well casing. The land surface is also appropriately sloped away from the well providing adequate surface water drainage. It is unknown if the well was grouted according to ADEC regulations. Proper grouting provides added protection against contaminants travelling along the well casing and into source waters.

This system operates seasonally and serves no residents and more than 25 non-residents through one service connection.

UPPER TROUBLESOME CREEK DRINKING WATER PROTECTION AREA

In order to evaluate whether a drinking water source is at risk, we must first evaluate what are the most likely pathways for surface contamination to reach the groundwater. Some areas are more likely to allow contamination to reach the well than others. These areas are determined by looking at the characteristics of the soil, groundwater, aquifer, and well.

The most probable area for contamination to reach the drinking water well is the area that contributes water to the well, the groundwater recharge area. This area is designated as the Drinking Water Protection Area (DWPA). Because a release of contaminants within the DWPA are most likely to impact the drinking water well, this area will serve as the focus for voluntary protection efforts.

An analytical calculation was used to determine the size and shape of the DWPA. The input parameters describing the attributes of the aquifer in this calculation were adopted from the U.S. Geological Survey (*Patrick, Brabets, and Glass, 1989*), and State of Alaska Department of Water Resources. Additional methods were also used to take into account any uncertainties in groundwater flow and aquifer characteristics to arrive at a meaningful DWPA (Please refer to the Guidance Manual for Class B Public Water Systems for additional information).

The DWPAs established for wells by the ADEC are separated into four zones. These zones correspond to differences in the time-of-travel (TOT) of the water moving through the aquifer to the well. The time of travel for contaminants within the water varies and is dependent on the physical and chemical characteristics of each contaminant. The following is a summary of the four DWPA zones and the calculated TOT for each:

Table 1. Definition of Zones

Definition
¹ / ₄ the distance for the 2 year TOT
Less than the 2 year TOT
Less Than the 5 year TOT
Less than the 10 year TOT

As an example, water moving through the aquifer in Zone B will reach the well in less than 2 years from the time it crosses the outer limit of Zone B.

Zone A also incorporates the area downgradient from the well to take into account the area of the aquifer that is influenced by pumping of the well. Water within the aquifer in Zone A will reach the well in several hours to several months.

INVENTORY OF POTENTIAL AND EXISTING CONTAMINANT SOURCES

The Drinking Water Protection Program has completed an inventory of potential and existing sources of contamination within the Upper Troublesome Creek Campground DWPA. This inventory was completed through a search of agency records and other publicly available information. Potential sources of contamination to the drinking water aquifer include a wide range of categories and types. Potential drinking water contaminants are found within agricultural, residential, commercial, and industrial areas, but can also occur within areas that have little or no development.

For the basis of all Class B public water system assessments, three categories of drinking water contaminants were inventoried, they include:

- Bacteria and viruses;
- Nitrates and/or nitrites; and
- Volatile organic chemicals.

Inventoried potential sources of contamination within Zones A through Zone D were associated with residential and light industrial type activities. The sources are summarized in the tables in Appendix B.

RANKING OF CONTAMINANT RISKS

Once the potential and existing sources of contamination have been identified, they are sorted and ranked according to what type and level of risk they represent. Ranking of contaminant risks for a "potential" or "existing" source of contamination is a function of toxicity and volumes of specific contaminants associated with that source. Further, contaminant risks are a function of the number and density of those types of contaminant sources as well as the proximity of those sources to the well.

VULNERABILITY OF UPPER TROUBLESOME CREEK DRINKING WATER SOURCE

Vulnerability of a drinking water source to contamination is a combination of two factors:

- Natural susceptibility; and
- Contaminant risks.

Each of the three categories of drinking water contaminants has been analyzed and an overall vulnerability score of 0 to 100 is ultimately assigned:

Natural Susceptibility (0 – 50 points)

. .

Contaminant Risks (0 - 50 points)

=

Vulnerability of the Drinking Water Source to Contamination (0 - 100).

A score for the Natural Susceptibility is achieved by analyzing the properties of the well and the aquifer.

Susceptibility of the Wellhead (0 - 25 Points)

Susceptibility of the Aquifer (0 - 25 Points)

=

Natural Susceptibility (Susceptibility of the Well) (0 - 50 Points)

The well for Upper Troublesome Creek Campground is completed in an unconfined aquifer setting. Because an unconfined aquifer is recharged by surface water and precipitation that migrates downward from the surface, contaminants at the surface have the potential to adversely impact this aquifer. Table 2 shows the Overall Susceptibility score and rating for Upper Troublesome Creek Campground.

Table 2.	Natural Susceptibility - Susceptibility of
the W	ellhead and Aquifer to Contamination

	Score	Rating
Susceptibility of the	5	Low
Wellhead		
Susceptibility of the	15	High
Aquifer		-
Natural Susceptibility	20	Medium
· ·		

Contaminant risks to a drinking water source depend on the type, number or density, and distribution of contaminant sources. This data has been derived from an examination of existing or historical contamination that has been detected at the drinking water source through routine sampling. It also evaluates potential sources of contamination. Table 3 summarizes the Contaminant Risks for each category of drinking water contaminants.

Table 3. Contaminant Risks

Category	Score	Rating
Bacteria and Viruses	12	Low
Nitrates and/or Nitrites	12	Low
Volatile Organic Chemicals	12	Low

Appendix D contains eight charts, which together form the 'Vulnerability Analysis' for a source water assessment for a public drinking water source. Chart 1 analyzes the 'Susceptibility of the Wellhead' to contamination by looking at the construction of the well and its surrounding area. Chart 2 analyzes the 'Susceptibility of the Aquifer' to contamination by looking at the naturally-occurring attributes of the water source and influences on the groundwater system that might lead to contamination. Chart 3 analyzes 'Contaminant Risks' for the drinking water source with respect to bacteria and viruses. The 'Contaminant Risks' portion of the analysis considers potential sources of contaminants as well as a review of contamination that has or may have occurred, but has not arrived or been detected at the well. Lastly, Chart 4 contains the 'Vulnerability Analysis for Bacteria and Viruses.' Charts 5 through 8 contain the Contaminant Risks and Vulnerability Analyses for nitrates and nitrites and volatile organic chemicals, respectively.

Table 4 contains the overall vulnerability scores (0 - 100) and ratings for each of the three categories of drinking water contaminants. Note: scores are rounded off to the nearest five.

Table 4. Overall Vulnerability of Upper					
Troublesome Creek Campground to Contamination					
by Category					

Category	Score	Rating
Bacteria and Viruses	30	Low
Nitrates and Nitrites	30	Low
Volatile Organic Chemicals	30	Low

Tables 2 through 4 in Appendix B contain the ranking of potential and existing sources of contamination with respect to bacteria and viruses, nitrates and/or nitrites, and volatile organic chemicals.

The paved and gravel roads; non-residential pit toilets; and water supply wells create a risk increase for the bacteria and viruses, nitrates and nitrites, and volatile organic compounds.

Only a small amount of bacteria and viruses are required to endanger public health. Bacteria and viruses have not been detected during recent water sampling of the system at Upper Troublesome Creek Campground.

Nitrates and/or nitrites are found in natural background concentration at this site, as elsewhere throughout Alaska. Nitrate concentrations in uncontaminated groundwater are typically less than 2 milligrams per liter (mg/L) and are derived primarily from the decomposition of organic matter in soils, adopted from the U.S. Geological Survey (Wang, et al., 2000).

Sampling history for Upper Troublesome Creek Campground well indicates that concentrations of nitrate have not been detected (see Chart 5 -Contaminant Risks for Nitrates and/or Nitrites in Appendix D). The Maximum Contaminant Level is the maximum level of contaminant that is allowed to exist in drinking water and still be consumed by humans without harmful health effects. Due to the high solubility and weak retention by soil, nitrates are very mobile, moving at approximately the same rate as water.

The paved and gravel roads; non-residential pit toilets; and water supply wells located in Zone B form the greatest risk for volatile organic chemicals.

SUMMARY


A Source Water Assessment has been completed for the sources of public drinking water serving Upper Troublesome Creek Campground. The overall vulnerability of this source to contamination is Low for volatile organic chemicals, Low for bacteria and viruses, and Low for nitrates and nitrites. This assessment of contaminant risks can be used as a foundation for local voluntary protection efforts as well as a basis for the continuous efforts on the part of Upper Troublesome Creek Campground to protect public health. It is anticipated that Source Water Assessments will be updated every five years to reflect any changes in the vulnerability and/or susceptibility of Upper Troublesome Creek Campground public drinking water source.

REFERENCES CITED

- Patrick, L.D., Brabets, T.P., and Glass, R.L., 1989, Simulation of ground-water flow at Anchorage, Alaska: US Geological Survey Water-Resources Investigations Report 88-4139, 41p.
- Wang, B., Strelakos, P.M., and Jokela, J.B., 2000, Nitrate source indicators in ground water of the scimitar subdivision, Peters Creek Area, Anchorage, Alaska: US Geological Survey Water-Resources Investigations Report 00-4137.
- Weather Underground, June 18, 2002, Web extension to the *Western Regional Climate Center* [WWW document]. URL <u>http://www.wunderground.com</u>

APPENDIX A

Upper Troublesome Creek Campground Drinking Water Protection Area (Map 1)

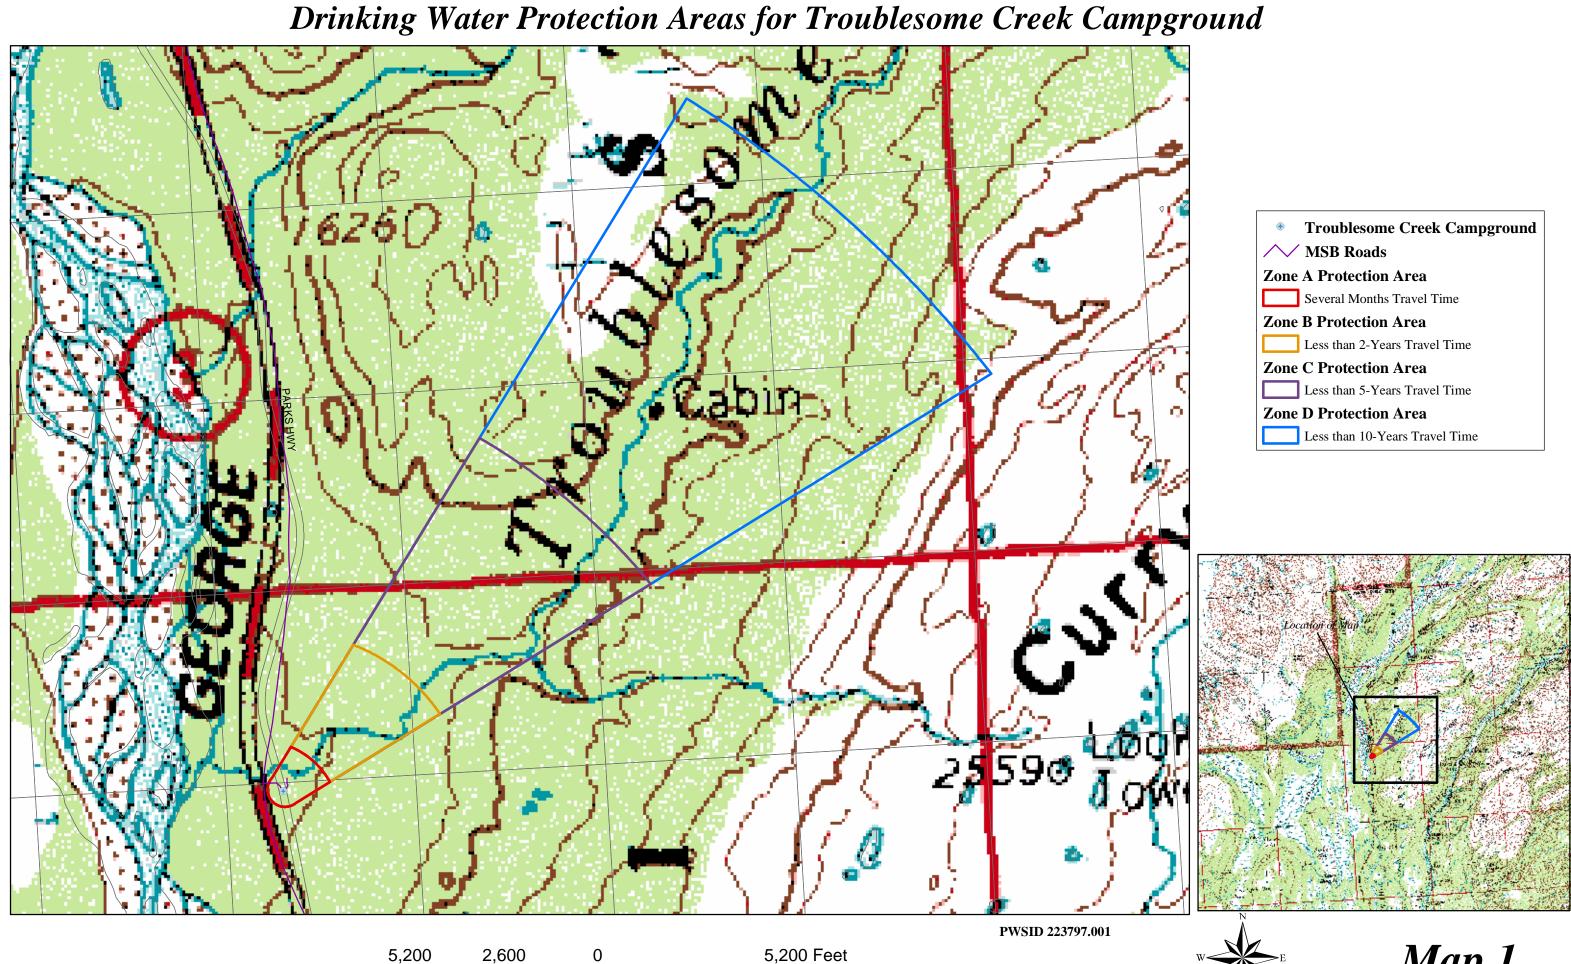

2,600 0





APPENDIX B

Contaminant Source Inventory and Risk Ranking for Upper Troublesome Creek Campground (Tables 1-4)

Table 1

Contaminant Source Inventory for **Div of Parks Troublesome Creek**

Contaminant Source Type	Contaminant Source ID	CS ID tag	Zone	Location	Map Number	Comments
Pit toilets (vaulted) nonresidential (one or more)	D17	D17-1	А	End of Access Road, east side	3	
Highways and roads, dirt/gravel	X24	X24-1	А	Access Road 1	2	

Contaminant Source Inventory and Risk Ranking for

PWSID 223797.001

Div of Parks Troublesome Creek

Sources of Bacteria and Viruses

Contaminant Source Type	Contaminant Source ID	CS ID tag	Zone	0	Overall Rank after Analysis		Map Number Comments
Pit toilets (vaulted) nonresidential (one or more)	D17	D17-1	А	Low	1	End of Access Road, east side	3
Highways and roads, dirt/gravel	X24	X24-1	А	Low	2	Access Road 1	2

Table 2

Contaminant Source Inventory and Risk Ranking for

PWSID 223797.001

Div of Parks Troublesome Creek

Sources of Nitrates/Nitrites

Contaminant Source Type	Contaminant Source ID	CS ID tag	Zone	0	Overall Rank after Analysis		Map Number Comments
Pit toilets (vaulted) nonresidential (one or more)	D17	D17-1	А	Low	1	End of Access Road, east side	3
Highways and roads, dirt/gravel	X24	X24-1	А	Low	2	Access Road 1	2

Table 3

Table 4

Contaminant Source Inventory and Risk Ranking for

PWSID 223797.001

Div of Parks Troublesome Creek


Sources of Volatile Organic Chemicals


Contaminant Source Type	Contaminant Source ID	CS ID tag	Zone	0	Overall Rank after Analysis		Map Number	Comments
Highways and roads, dirt/gravel	X24	X24-1	А	Low	1	Access Road 1	2	


APPENDIX C

Upper Troublesome Creek Campground Drinking Water Protection Area and Potential and Existing Contaminant Sources (Maps 2-3)

Drinking Water Protection Areas for Troublesome Creek Campground and Potential and Existing Sources of Contamination

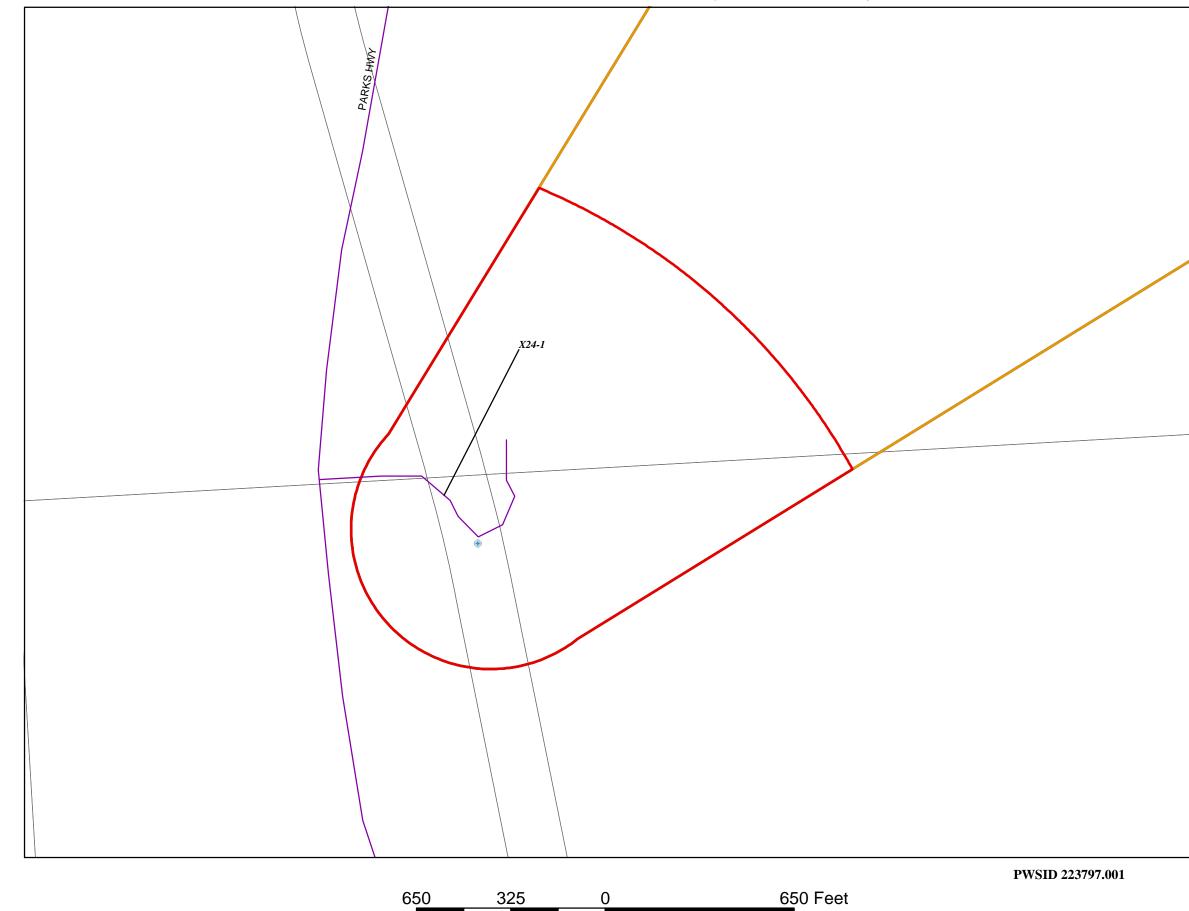


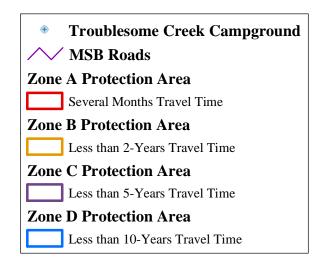


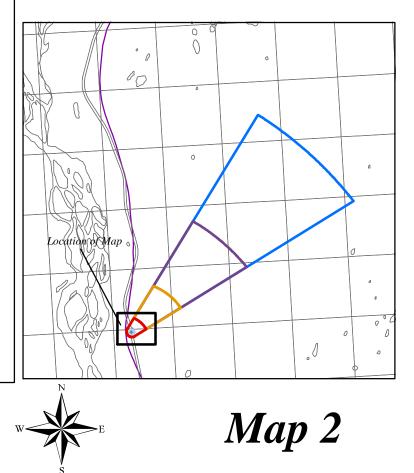





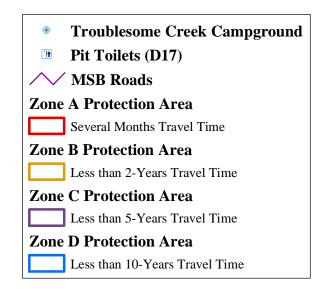

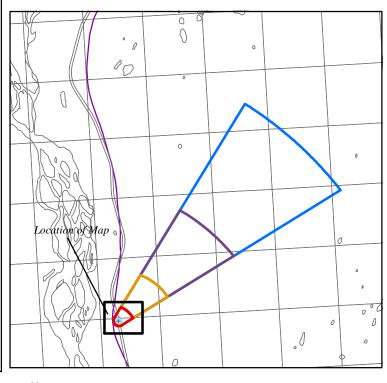



Map 3

APPENDIX D

Vulnerability Analysis for Upper Troublesome Creek Campground Public Drinking Water Source (Charts 1-8)

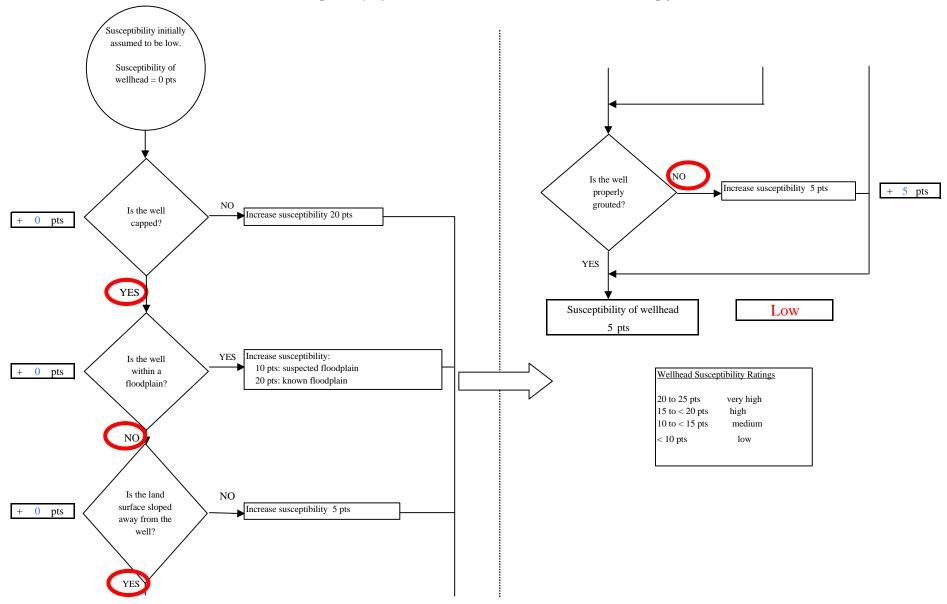
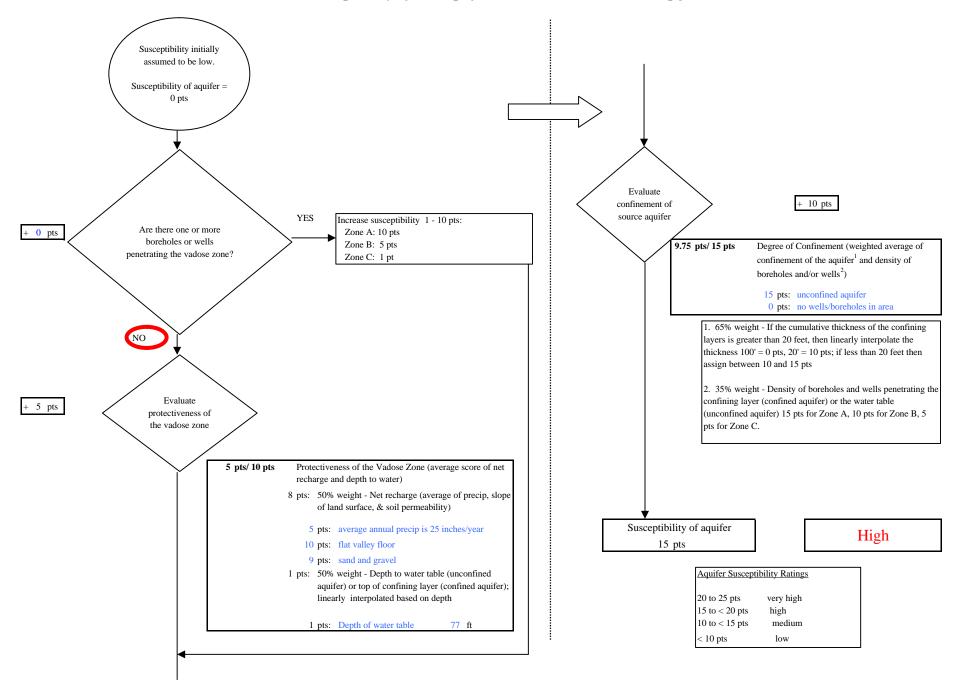
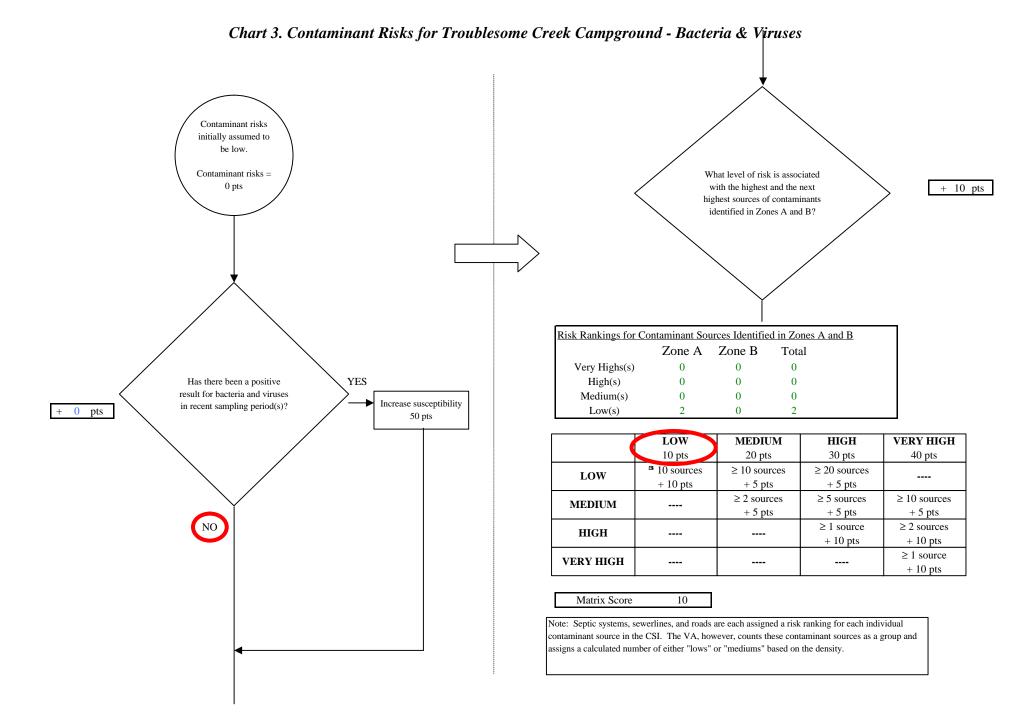


Chart 1. Susceptibility of the Wellhead - Troublesome Creek Campground

Chart 2. Susceptibility of the Aquifer - Troublesome Creek Campground





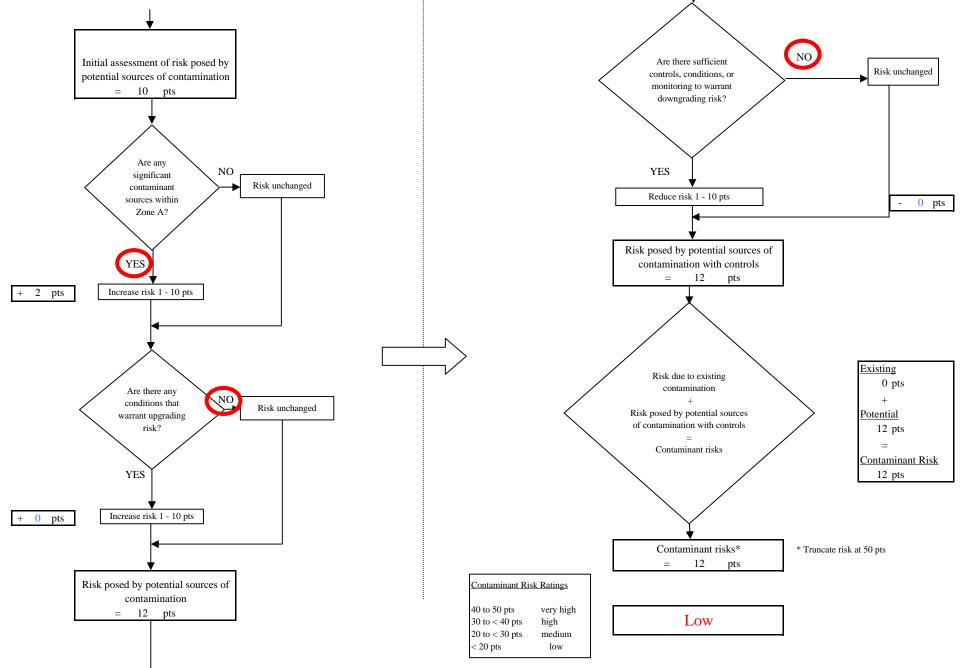


Chart 3. Contaminant Risks for Troublesome Creek Campground - Bacteria & Viruses

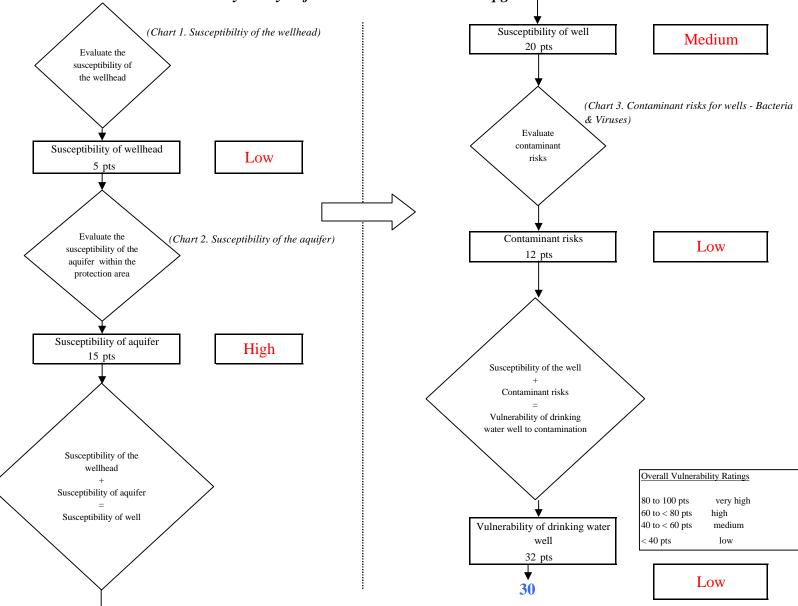
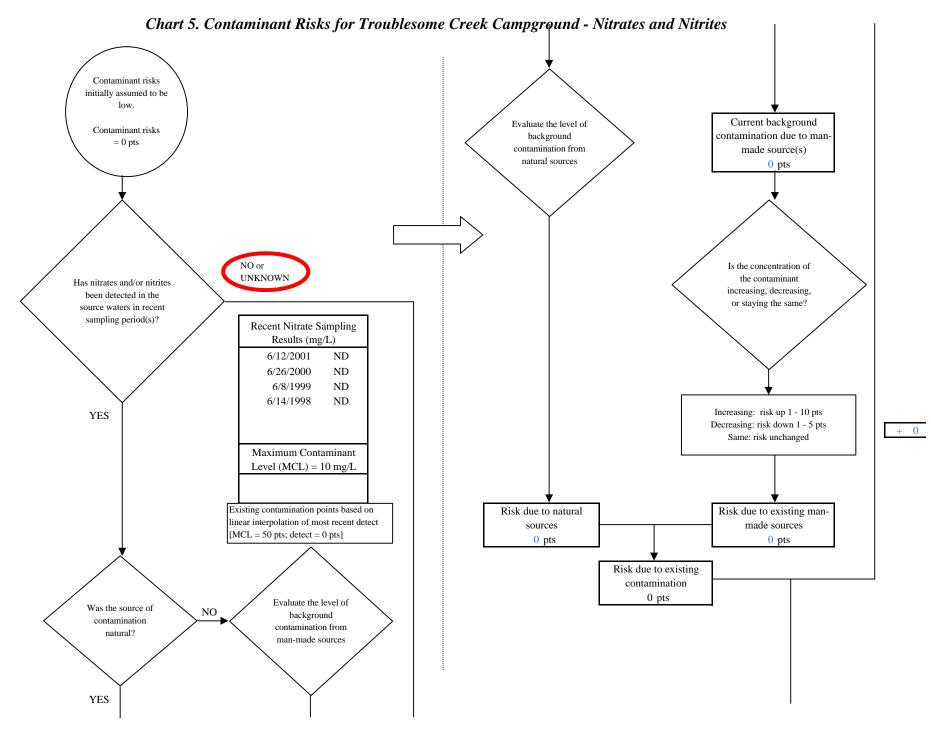
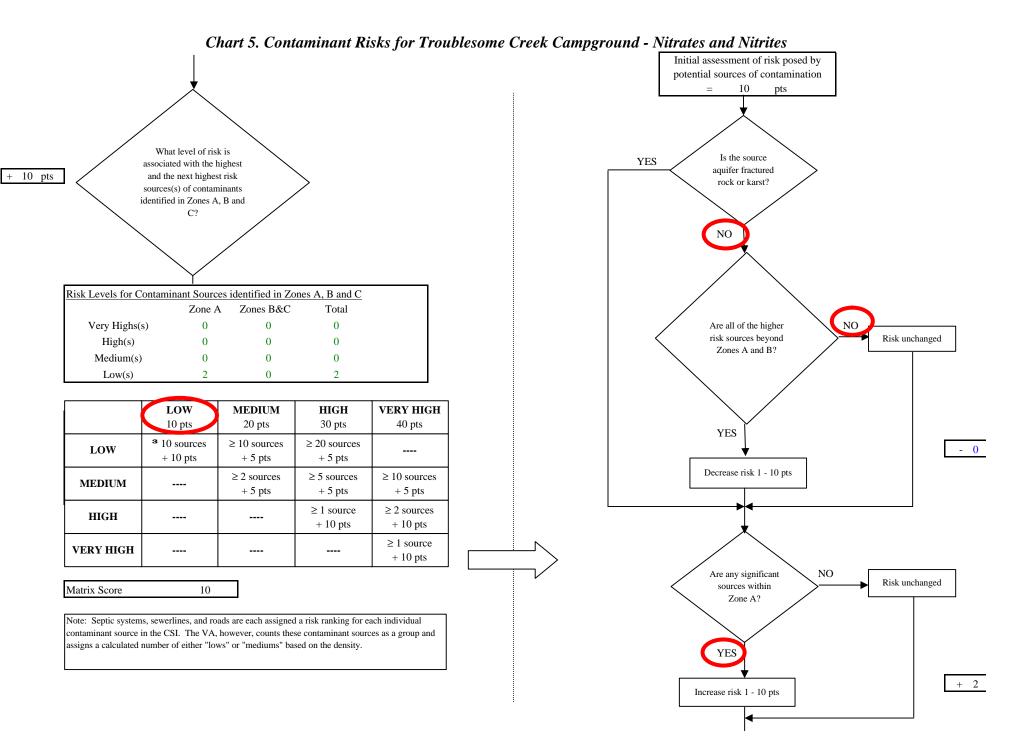


Chart 4. Vulnerability Analysis for Troublesome Creek Campground - Bacteria & Viruses





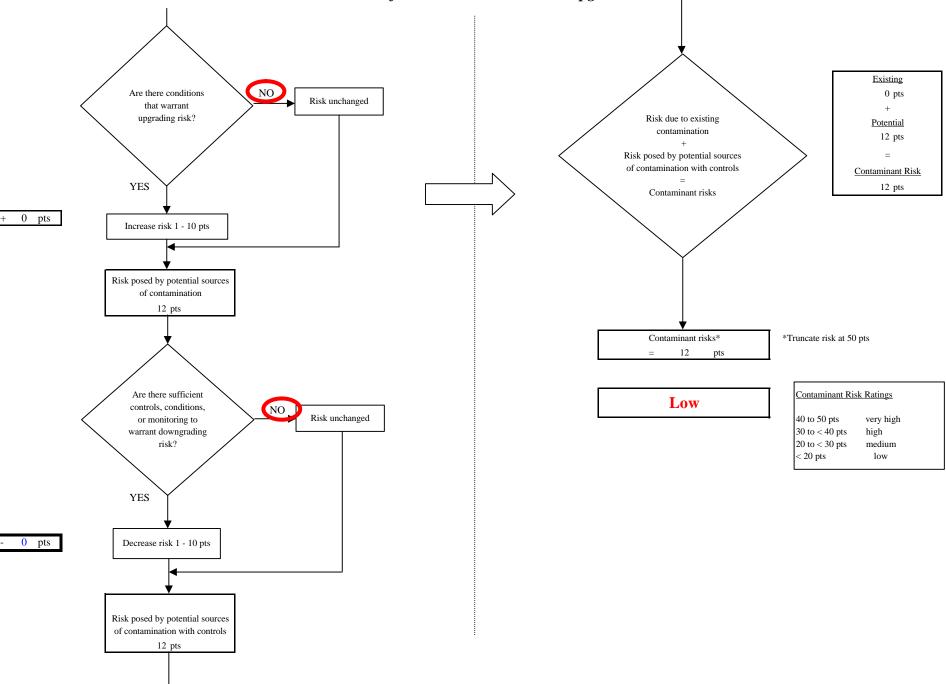


Chart 5. Contaminant Risks for Troublesome Creek Campground - Nitrates and Nitrites



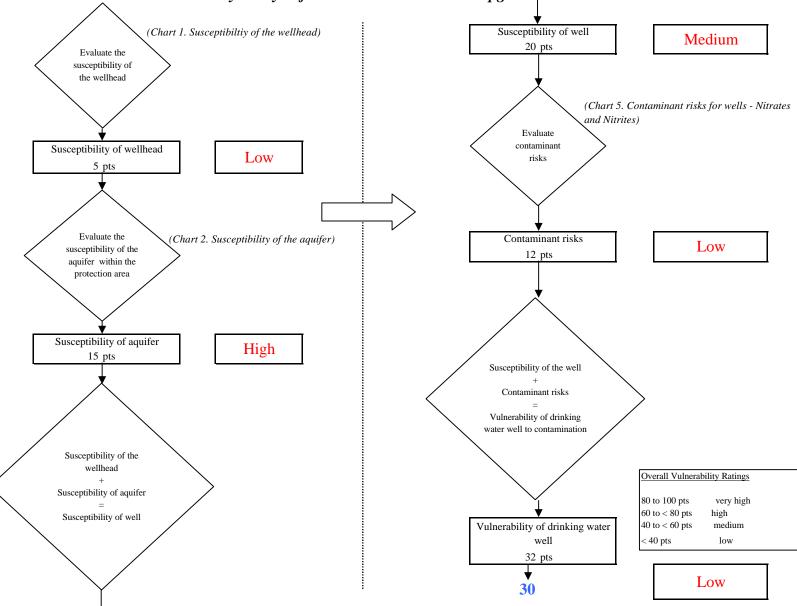


Chart 6. Vulnerability Analysis for Troublesome Creek Campground - Nitrates and Nitrites

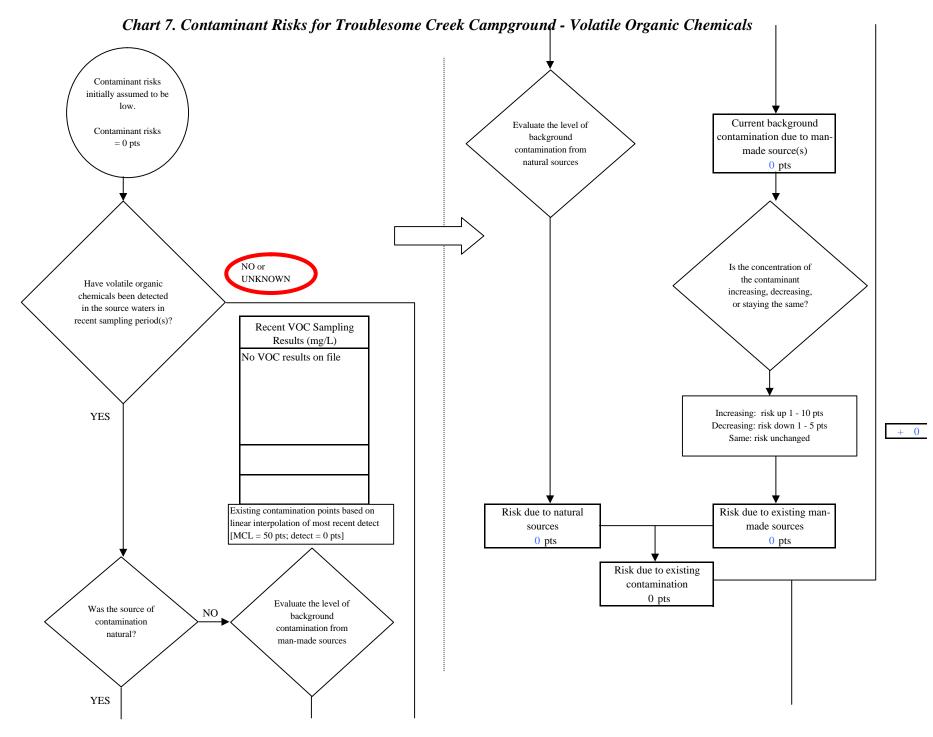

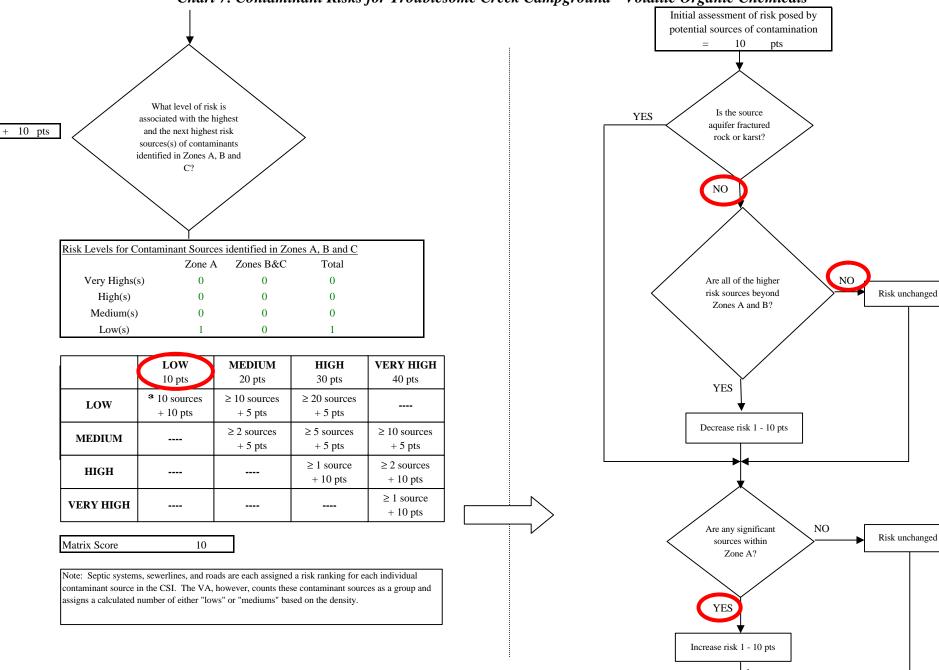

- 0

+ 2

Chart 7. Contaminant Risks for Troublesome Creek Campground - Volatile Organic Chemicals

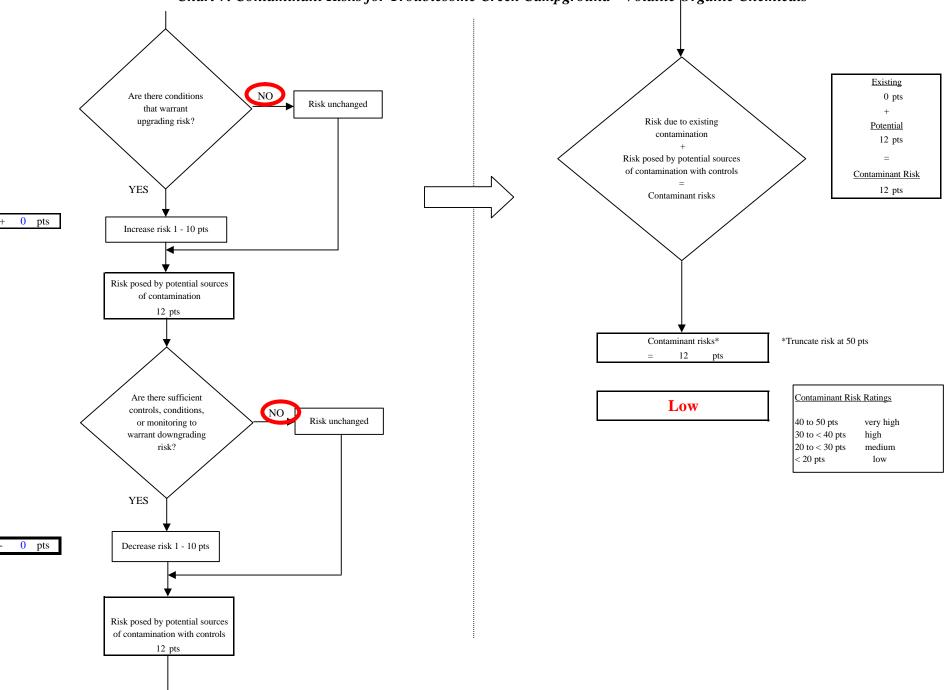


Chart 7. Contaminant Risks for Troublesome Creek Campground - Volatile Organic Chemicals

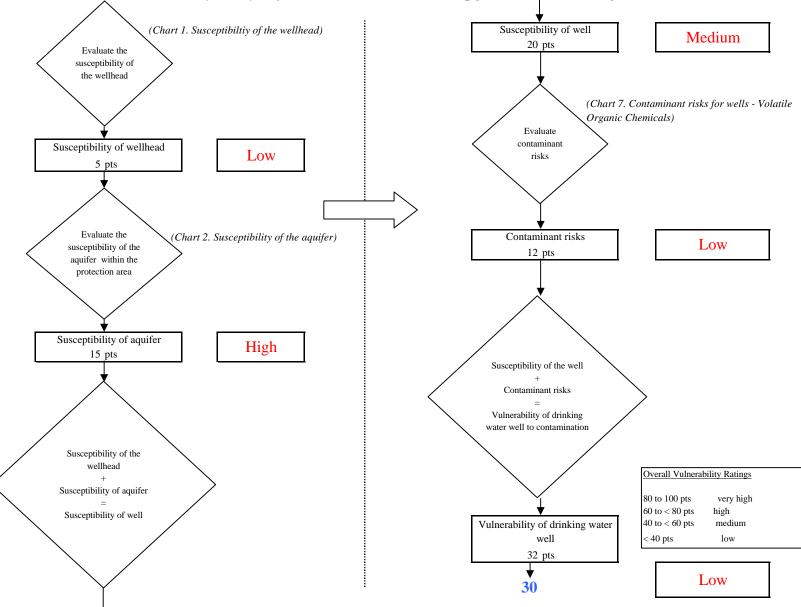


Chart 8. Vulnerability Analysis for Troublesome Creek Campground - Volatile Organic Chemicals